

LSO T42N-R26W H13

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

or corners in

Menominee	Located In:	Corner Code #
(County)		
Public Land Survey	T 41N R 26W	F03
	T 41N R 26W	H01
	T	
Property Controlling	S T	
n Section	S T	
	S T	
Miscellaneous	S T	
Property in Sec.	S T	

i. Lot No. _____, Recorded Plat _____
j. Private Claims _____

Jeremy J. Pipp, in a field survey on 8/20/2014
8/21/2014 do hereby state

that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(F03) Quarter corner common to Sections 4 and 9. 1852: E.C. Martin, DS. Set quarter section post witnessed by Spruce 8 S26E 4 links (2.64'), Cedar 10 N54W 26 links (17.16'). 2014: Found wood post and adjacent Northern Paper Mills location tag.

(H01) Quarter corner common to Sections 3 [T41N-R26W] and 34 [T42N-R26W]. 1846: John Burt, DS. Set quarter section post witnessed by Cedar 6 N55E 9 links (5.94'), Cedar 7 N51W 22 links (14.52'). 1962: Kimberly Clark (Neal Sperhake PS#7876) Set 1" pipe with 4" Aluminum cap by proportionate method witnessed by Balsam 10 N33E 75 1/2 links (49.83'), Aspen 3 S20W 27 1/2 links (18.15').

3. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(F03) No evidence of original survey. Location has been altered by Road construction activities; proportionate location falls in the centerline of the Murray Road. Corner position reestablished by single proportionate measurement between the Southwest corner and the Southeast corner of Section 4 (monument placed 6 inches below grade of existing gravel road). Position is accepted as a careful and faithful REESTABLISHMENT of the position of the original corner. Found Wood Post is S19E 31.5 feet from monumented corner.

(H01) Accepted found Kimberly Clark Monument and adjacent post (no traces of OBT or NBT Witnesses); location is +/-80 feet East of existing gravel road. Position is accepted as a careful and faithful REESTABLISHMENT of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(F03) DNR monument
7" Tamarack N52E 28.71' (1/4S,NBT)
7" B. Spruce S48W 41.33' (1/4S,NBT)
7" Tamarack N61W 31.08' (1/4S,NBT)
8" Tamarack N20W 17.00' (1/4S,NBT)

All trees are blazed, scribed, painted, and signed. Measurements are to nail in side of tree, bearings are magnetic. A Metal sign post was set North 15.0 feet.


Signed by Jeremy J. Pipp
Surveyor's Michigan License No. 50447

For the Michigan Department of Natural Resources

(H01) Kimberly Clark monument
7" Spruce S68E 28.46' (1/4S,NBT)
7" Balsam S40E 20.31' (1/4S,NBT)
7" Balsam SOUTH 41.94' (1/4S,NBT)
3" Poplar N49W 55.54' (1/4S,NBT)

All trees are blazed, scribed, painted, and signed. Measurements are to nail in side of tree, bearings are magnetic. A Metal sign post was set East 1.5 feet.

Date August 26, 2014

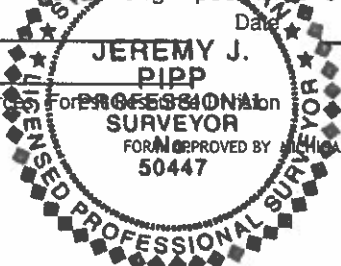

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													