

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Montmorency (County) Located In: Rust Township Corner Code # 6-1  
1. Public Land Survey T 30 N R 4 E  
T R  
T R  
T R  
2. Property Controlling S T R  
in Section S T R  
3. Miscellaneous S T R  
Property in Sec. S T R

JUN 02 95  
STATE OF MICHIGAN  
MONTMORENCY COUNTY  
Recorded & Filed

09-22-1995 11:26:51

A. PANGAN-MCELROY  
Register of Deeds & File Number

4. Lot No. , Recorded Plat  
5. Private Claims

I, Larry G. Beauregard, in a field survey on May 30, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

5-1840, Lewis Clason, Deputy Surveyor, Set a post. Witnesses marked: (S 14° E 8 links 5" Tamarack) (N 18° W 13 links 6" W. Birch).

No Date, Frank N. Smith, P.S. #754, Ran the line North and South between Sections 3 and 4 and most likely found or reset corner but no data available to confirm same.

8-24-1973, Mark Ennis, PORTER'S SURVEY, Set 1/2" rod with cap 81.25' West of South 1/4 corner of Section 33, T 31 N, R 4 E on line between the South 1/4 corner and the Southwest corner of Section 33, T 31 N, R 4 E and due North of old 5" x 5" square stake on East-West fence line at old fence corner in line with the old fence to South. Witnesses marked: (S 50° W 6.43' Fence post) (South 3.53' old corner fence post) (S 75° E 22.50' Fence post).


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" rod with cap mentioned above by Porter's survey, 81.25' West of S. 1/4 corner, Section 33, T 31 N, R 4 E. No witnesses mentioned above were found. The 5" x 5" square post was not found either. A new East & West fence line has been built sometime after the Porter survey in 1981.

SURVEY &  
REMONUMENTATION

DEC 18 1995

COMMISSION

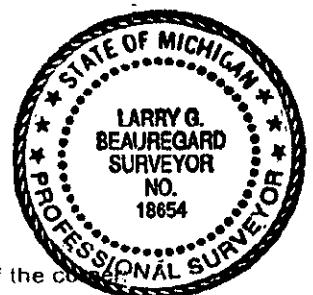

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner common to Sections 3 and 4, T 30 N, R 4 E

Placed 4" diam., x 36" standard concrete monument and Montmorency County Remonumentation Cap P.S. #18654. Accepted as the best available evidence of the position of the original corner. Approved by the Peer Group on June 2, 1995.

Due North 91.42' Tw. 4" Apples - Placed 60d penny spike & P.S. tag #18654  
N 20° W 156.06' 10" W. Pine - Placed 60d penny spike & P.S. tag #18654  
S 85° W 27.05' 2nd fence post West of corner post. - Placed P.K. nail & P.S. tag #18654  
S 75° W 19.55' 2nd fence post East of corner post. - Placed P.K. nail & P.S. tag #18654

Signed by Larry G. Beauregard  
Surveyor's Michigan License No. 18654

Date 9/22/95