

JAN 18 2001

SECTION

STATE OF MICHIGAN
COUNTY OF OCEANA
RECEIVED FOR RECORD

21 DEC 2000 3:15:38 PM

JOSEPH E. MERTEN
REGISTER OF DEEDSLAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Oceana
(County)

Located In:

Corner Code #

1. Public Land Survey

T	16N	R	17W	D-9
T		R		
T		R		
T		R		
T		R		
S		T	R	
S		T	R	
S		T	R	
S		T	R	

2. Property Controlling
in Section3. Miscellaneous
Property in Sec.

101000

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, J. Randolph Hepworth, in a field survey on May 2, 2000, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	10		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

D-9 1/4 CORNER COMMON TO SECTIONS 20 & 29 T16N, R17W WEARE TOWNSHIP

GLO John Hodgson 1838 SET POST 10" Beech N70°E 32 lks 10" Beech S65°W 6 lks

MDSH Corner Witness O. Wiggins May 1970 Found 5/8" rod, buried 20", raised with 1 1/2" pipe, set Mon Box 1.6 Ft. south of Road C/L
Unrecorded Survey, J.R. Hepworth #26457, 8/96 Mon Box

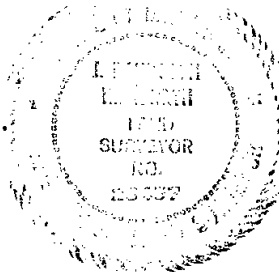
B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

I found a 1 1/2" x 17" Pipe inside a monument box, 1.6' South of the centerline of E-W highway. Old occupation lines run to North and to South. At 20" deep, I found a 5/8" Iron as described by MDSH, 1970.

I accept the Iron and monument box as the best available evidence of the position of the original corner. No evidence is known to me that would lead me to believe the corner should be at another location.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 2 1/2"x20" Harrison Cast Iron Monument, stamped "County Survey" and "26457" inside the monument box at the position of the pipe				
Set 60d spk	W Face	4"x6" wood sign post	187°az	41.54' EDM
Set 60d spk	NE Face	Power Pole	119°az	75.25' EDM
Set 60d spk	NW Face	Power Pole	63°az	91.19' EDM
Set 60d spk	W Face	Power Pole	North	34.80' EDM

Oceana County Remonumentation
Peer Group Reviewed & ApprovedDate: 11-21-00JRH
J. Randolph Hepworth
Oceana County SurveyorSigned by J. Randolph Hepworth
Surveyor's Michigan License No. 26457Date December 15, 2000