

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ontonagon

(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---|-------------|
| 1. Public Land Survey | T <u>53N</u> R <u>38W</u> | <u>K8</u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| 2. Property Controlling in Section | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| 3. Miscellaneous Property in Sec. | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

May 16 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		17		16		15		14		13	
7													
8		19		20		21		22		23	●	24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													


A. Description of original monument and accessories and/or subsequent restoration:
 (K8) Quarter corner common to Sections 23-24. Established in 1846 by Higgins and Hubbard: North between 23 & 24...40.00 Set 1/4 Section post. Hemlock 30 S25W 23, Balsam 10 N75E 14...80.00 Cor. Secs. 13, 14, 23, 24. Corner recorded in 1965 by Billy D. Buckler: Cedar post set at intersection of blazed lines and cutting edges. 14" Cedar S30E 04.5 links, 9" Hard Maple N40E 12 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K8) The original post and accessories were not recovered. Found, but did not accept Buckler's 1965 post with adjacent 3/4" iron pipe placed by unknown persons. Buckler's 1965 field notes clearly state that the post he placed at this position is an approximate ("temporary") corner position. Further, it does not fit with the U.S. record. Reestablished the corner by single proportionate measurement to the original record between section corners 2640.00' north and south. The reestablished position is also in accord with U.S. stream calls to the north and south. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the corner, Buckler's post bears N 14 deg. E, 193.5' distant.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

(K8) Set 1" pipe with 4" MDNR cap.
 Blazed and scribed the following:
 9" Cedar N20E 42.7' "1/4S NBT"
 20" Hemlock S68E 30.0' do
 9" Sugar S12E 22.3' do
 17" Sugar S72W 23.5' do
 Bearings are magnetic. Distances to notch in lower blaze.

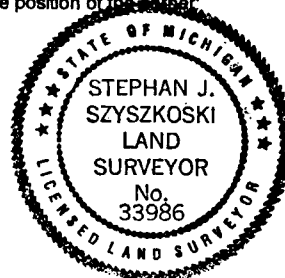

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 8/15/00

For the Michigan Department of Natural Resources - Forest Management Division