SURVEY & REMONUMENTATION

-MAY 0 5 1997

RECORDED

LAND CORNER RECORDATION CERTIFICATE 1996 DEC 18 AM 11: 15 Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

Dickinson (County)	Located In:	Corner Code #
1. Public Land Survey	T_40N_R_29W T_40N_R 28 W TR TR	M-7*
2. Property Controlling in Section	S T R S T R	
3. Miscellaneous Property in Sec	S T R S T R	

REGISTER OF DEEDS DICKINSON COUNTY RON MOUNTAIN MI 49801

Register of Deeds Stamp & File Numbe


_ , Recorded Plat _ 5. Private Claims

, in a field survey on 24 October Michael Mileski _, 19 <u>96</u> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- M-7; Section Corner common to Sections 13 and 24, T40N, R29W;

See back of form.

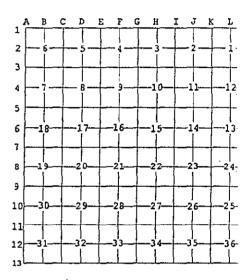

ACCEPTED BY THE DICKINSON COUNTY SURVEY PUER GROUP AS THE LARE ALLO OT SURVEY BURNER MICHIGAN PUBLIC OT S45 OF 1060 AT A MEETING HELD ON 17-96

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner

M-7; Section Corner common to Sections 13 and 24, T40N, R29W;

RAP COUNTY REPRESENTATIVE

Found a 1" x 42" galvanized iron pipe with a 4" brass cap as set by Mr. Buckler in 1955. Mr. Buckler's monument was found to be in agreement with his new bearing trees as described in Part A. Replaced Mr. Buckler's monument with a standard county monument as described in Part C. Accepted as the best available evidence of the position of the original corner.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- M-7; Section Corner common to Sections 13 and 24, T40N, R29W;

Set a 5/8" x 36" aluminum rod with a 3" aluminum cap stamped as to location projecting 4" above the ground.

Set 7" spike	SE/side	7" Red Maple	N41°E	9.79'
Set 7" spike Set 7" spike	SW/side W/side	7" Sugar Maple 10" Sugar Maple	S60°E S20°E	38.90' 29.59'
Set 7" spike	N/side	12" Sugar Maple	S59°W	54.59'
		Location Post	North	3.0'

All of the above new bearing trees are marked with upper and lower blazes. The lower blaze is scribed "NBT". Both blazes as well as a band around the tree at the upper blaze are painted red.

* This corner is also A-7 of T40N, R28W.

OF MICHIG MICHAELD MILESKI PROFESSIONAL SURVEYOR No. 39091 OFESSION

Signed by Maria Maria	Date 3 Dec 1996
Surveyor's Michigan License No. 39091	8k 17M no 1 & 2