

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

(County)

Located In:

Corner Code #

1. Public Land Survey

T R
T R
T R
T R

2. Property Controlling in Section

S 23 T 41N R 30W 7
S 23 T 41N R 30W 1

3. Miscellaneous Property in Sec.

S T R
S T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

Jun 27 2000

I, Stephan J. Szyszkoski, in a field survey on , 19 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


- (7-Sec. 23) North 1/16 corner between Sections 23 & 24. Corner not established in the original survey. Found no subsequent record.
(1-Sec. 23) West 1/16 corner between Sections 14-23. Corner not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (7-Sec. 23) Established the corner midway and on a straight line between Section corner 1336.86' north and Quarter corner 1336.86' south. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the corner monumented, an old N-S fence, more or less down on the ground, is 28' Easterly.
(1-Sec. 23) Found and accepted a 5/8" dia. rebar with plastic cap #12027 (R.F.Perkins) at the corner. My measurements to Section and 1/4 corners west and east show it to be a careful and faithful determination of the position of the corner. At the position of the found monument, I placed a 1" IDx 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Placed the found monument adjacent.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|--|--|
| (7) Set 1" pipe with 4" MDNR cap. | (1) Set 1" pipe with 4" MDNR cap. |
| Blazed and scribed the following: | Blazed and scribed the following: |
| 5" Maple N18E 6.2' 1/16S BT" | 9" Tamarack N50W 33.8' 1/16S BT" |
| 5" Maple S39E 15.8' do | 9" Spruce N02W 35.6' do |
| 3" Maple S01W 14.7' do | 6" Spruce S68E 31.2' do |
| 5" Maple N78W 15.1' do | 12" Tamarack S17W 63.0' do |
| Squared maple post adjacent. Bearings are magnetic. Distances are to notch in lower blaze. | Sq'd spruce post adjacent. Bearings are magnetic. Distances to notch in lower blaze. |

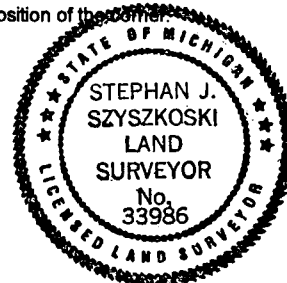

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 8/22/00

For the Michigan Department of Natural Resources - Forest Management Division