NOV 1 2 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74 Mich PA 1970


Register's Office ss.

or corners in	Filing Require	P.A. 1970 Received for record the	
Gogebic (County)	Located In:	Corner Code ##	18 78 day of September A. D. 1977 at 10:45 o'clock
. Public Land Survey	т <u>47N</u> R <u>44W</u> т в	G-1	A m., and recorded in
. Property Controlling		G-13	Famona Colling Deput Register of Decel
in Section Miscellaneous Property in Sec.	S T R S T R S T R		Register of Deeds Stamp & File Number
Lot No	, Recorded Plat		A B C D E F G H I J K L

Section Corner 3, 4, 33 & 34; T.47-48 N., R.44 W.

Richard I. Drahn in a field survey on September 10, 1997. Depreciation of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the surrent manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as

JOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

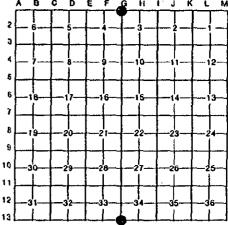

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by Austin Burt on August 11, 1847. Original B.T.s --- Hemlock 20" N.80 E. 45 links (29.70') --- Hemlock 14" N.74 W. 40 links (26.40') --- Sugar 8" S.45 E. 20 links (13.20') --- Hemlock 10" S.40 W. 25 links (16.50') ---

Corner restored on 9/12/72 by Donald D. Lappala (12585) from the remains of the three original Hemlock B.T.s and the stump hole of the Sugar B.T.. He set a 2" X 60" iron pipe monument with a 3" stamped brass cap and the following new B.T.s: --- 8" (10" dead) Sugar Maple N.25 E. (N.24 E.) 27.3'

3. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

--- 7" (9") Red Maple S.32 E. (S.30 E.)45.7' (45.70') --- 4" (5" dead) Sugar Maple S.60 E. (S.62 E.)19.0' --- Metal sign post N.02 W. (N.01 W.) 2.3' (2.33') ---

Corner recorded in USFS Liber, Page Z-13 on 12/9/74.

Recovered the corner as described and the bearing trees as indicated in parentheses above. Beavers have flooded out the first and third original B.T.s and stump holes are all that remain of the second and fourth B.T.

Research form on file with Gogebic County records.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

From	the	above	described	monument	т	established	the	following	nou	. m c
	0,120	45510	accer inca	monament	-	escapitalied	CHE	rorrowing	new	B.T.S.

5" Red Maple S.66 W. 21.18

5" Red Maple S.26 W. 44.19

Réchard L. Drahm 9/17/97
COUNTE BEPRESENTATION

RICHARD
L. DRAHN
LAND
SURVEYOR
No.
21564

Signed by Richard L. Drahn Date September 15, 1997

Surveyor's Michigan License No. _21564

USFS A-13

209

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983