

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton

(County)

Located In:

Corner Code #

1. Public Land Survey

T 52N R 36W J7
T 52N R 36W K9

2. Property Controlling
in Section

S T R
S T R

3. Miscellaneous
Property in Sec.

S T R
S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

May 19 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(J7) Quarter corner common to Sections 14-23. Corner established in 1846 by Sylvester Higgins: "West corrected between Sec. 14 & 23. 5.00 Set meander post on small lake, 13.00 over arm of lake and set post, 40.00 set 1/4 Sec. post Hemlock 36, S55W 9, do 20 N20E 19, 48.04 Lynn 15, 56.00 Set meander post, 63.00 Over arm of lake, 80.00 Sec. corner." Quarter corner is shown on drawing by C.A. Gibbs, found at office of Houghton Co. Equalization, no date but probably 1910-1920, monumented by an "I.P." from which an I.P. on the lakeshore bears N70-05W 158.1', an I.P. on the section line to the east is 1889.10', and an I.P. at K7 is easterly, 2617.60'. Corner shown on ASSESSOR'S PLAT OF LAKE ROLAND AND LITTLE LAKE GERALD, 1981, being S70-05E, 2758.49' from I7. Also shown on sketch by M.C. Larson, dated 1961, of SE1/4 of the SW1/4 of Section 14, monumented by an iron pin.

(K9) Corner common to Sections 23-24-25-26. Corner remonumented in 1964 by Billy D. Buckler, RLS: "This corner was replaced at a 1/2" iron pipe set by M.C. Larsen, Hancock. No original evidence found at this time. Corner monument 1" Iron Pipe with 4" Aluminum cap and 1/2" Iron Pipe. Witnesses to corner: 7" S. Maple S61W 38 links, 11" W. Maple N41E 63 links."

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(J7) The original post and accessories were not recovered. Found and accepted a 1 1/4" dia. iron pin projecting 10" above ground level, in accord with the above noted plat as defined by nearby concrete monuments along Twin Lakes Road and the NW'ly corner of lot 78. I found I7 of record N69 deg. 29' 55"W (true brg.) 2757.89'. I found the distance easterly to K7 to be 2614.75', and easterly to a 3/4" IP, apparently that shown on Gibb's drawing, 1887.81'. Left the 1 1/4" iron pin in place and marked new witnesses as described below. Corner recovered and re-witnessed by D.Lampela and B.Wheeler, Baraga District Office.

(K9) Recovered the 1964 monument as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum State of Michigan tablet, appropriately stamped, in good condition, at record bearing and distance from the 1964 witnesses. The N87 Maple SW was found in good condition. The N87 Sugar NE is now down. Left the monument in place and marked three new witnesses as described below. Corner recovered and re-witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J7) Found 1 1/4" iron pin.

Found the following trees marked with a BW blaze, not scribed, and a measuring nail in a washer stamped with #39478.

5" Maple S86W 15.4' to meas. nail
6" Maple S13E 8.15' do
6" Maple N83E 11.6' do
10" Maple N16W 47.3' do

Bearings are magnetic. Measuring nails are in low side blazes.

(K9) Found 1" pipe with 4" alum. cap.


Blazed and scribed:

8" Sugar S30W 16.15' "S26 N8T"
15" Spruce S78E 12.8' "S25 N8T"
10" Maple N32E 28.05' "S24 N8T"

The 1964 witness:

10" Maple S61W 25.2' "S26 N8T"

Bearings are magnetic. Distances are to notch in lower blaze. Placed squared maple post adjacent.

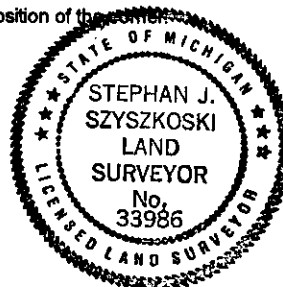

Signed by

Stephan J. Szyszkoski

Date

4-6-99

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division