

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

**SURVEY & REMONUMENTATION**


**FEB 15 2001**

For corners in IOSCO Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_

**SECTION**

1. Public Land Survey T 24N R 9E IJ-1  
T \_\_\_\_\_ R \_\_\_\_\_ Reference Corner  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
2. Property Controlling S \_\_\_\_\_  
in Section S \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
S \_\_\_\_\_ R \_\_\_\_\_  
3. Miscellaneous S \_\_\_\_\_  
Property in Sec. \_\_\_\_\_  
4. Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_

**064 2000**

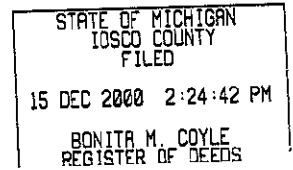

**Register of Deeds Stamp & File Number**

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

5. Private Claims \_\_\_\_\_

I, **WILLIAM E. WOODS P.S.** ; in a field survey on OCT. 16 , 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1843: ORIGINAL GOVERNMENT NOTES

SET POST 12.39 CHAINS EAST OF I-1  
W. BIRCH 10" S11°W 39 LKS.  
B.ASH 3" S53°E 24 LKS.

ACCEPTED BY THE IOSCO COUNTY  
SURVEY PEER GROUP AS THE  
OFFICIAL CORNER UNDER P.A.  
345 OF 1990 AT A MEETING  
HELD ON 10-11-2000

*James H. Shanger*

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1946: GOULD ENGINEERING

LAKE HURON SAND BEACH SUBDIVISION SHOWS SHORE LINE  
TRAVERSE 557.86' EAST OF I-13 T25N R9E

1970: RICHARD L. MILLER

LAKE HURON SAND BEACH SUBDIVISION SHOWS SHORE LINE  
TRAVERSE 557.86' EAST OF I-13 T25N R9E

1991: DUANE MCNEIL

SURVEY SHOWS MEANDER CORNER 451.05' EAST OF I-13 T25N R9E  
LCRC REMON CORNER IJ-13 M.P. NO REFERENCE TO DISTANCE EAST  
OF I-13 T25N R9E, BUT I MEASURED IT AT 477.16 EAST OF I-13 T25N  
R9E

1994: DAVID N. GUTHRIE

2000: WILLIAM E. WOODS

SURVEY SHOWING FOUND ALCONA REMON MEANDER CORNER  
477.16' EAST OF I-13 T25N R9E WHICH IS A REFERENCE CORNER

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

ACCEPTED ALCONA REMON REFERENCE CORNER RECORDED IN LIBER 1, PAGE 96 OF ALCONA COUNTY RECORDS.

CEDAR 12" N43°W 43.51'  
CEDAR 10" N75°W 48.83'  
MAPLE 6" S84°W 33.88'  
MAPLE 10" S59°W 42.90'

Signed by William E Woods

WILLIAM E. WOODS P.S.

Surveyor's Michigan License No. 25882

Date 12-06-2000

