

RE

MAR 09 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Iron</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>42N</u> R <u>34W</u>	<u>K-5.6 (007)</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

IRON COUNTY
MICHIGAN
RECEIVED FOR RECORD

99 DEC 30 AM 10:34

L.C. Records: L. 8, P. 134

Gary L. Pisoni
REGISTERED LAND SURVEYOR

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

South Meander Corner to Sections 14 and 13, T42N, R34W

I, Gary L. Pisoni, in a field survey on Nov. 20, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on October 7, 1851 by Guy H. Carleton, U.S. Deputy Surveyor.

Original Corner; Wood Post

Original Bearing Trees:

Hemlock	6"	S 58° W	14 lks (9.24 feet)
Cedar	14"	S 05° E	17 lks (11.22 feet)

In 1986, Gary L. Pisoni RLS restored the meander corner position from a found cedar bearing tree as described above. Cedar bearing tree is now 18" in diameter, lying on the ground with scribing visible. Set a rebar pin at record bearing and distance from the cedar B.T. Corner is approximately 5' from shoreline.

PEER GROUP APPROVED

Iron Aug. 2, 1999

COUNTY REPRESENTATIVE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original Cedar bearing tree found.

Found the rebar pin as described above.

Corner record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position, set a 3" diameter aluminum cap over the top of the existing rebar pin, stamped as follows: Iron County Remonumentation, T42N, R34W, M.C. S-14, S-13, 1999, RLS 27457 from which I established the following new blazed and scribed bearing trees: (All measurements taken to a nail in side of tree)


Hemlock	14"	S 31° E	19.28 feet
Hemlock	7"	S 68° W	7.80 feet
Hemlock	13"	N 74° W	18.44 feet
Steel sign post		S 17° W	4.0 feet

99-134

Signed by *Gary L. Pisoni*

Date 12-28-99

Surveyor's Michigan License No. 27457

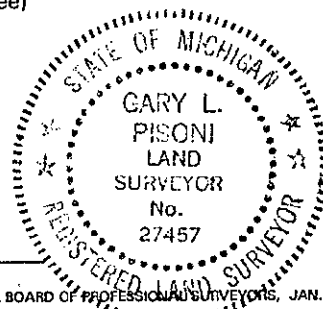

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995