

SURVEY & REMONUMENTATION

FEB 21 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Iron</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>31W</u>	<u>C.D-7w</u> <u>(00-7)</u>
	T <u> </u> R <u> </u>	
	T <u> </u> R <u> </u>	
	T <u> </u> R <u> </u>	
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	
	S <u> </u> T <u> </u> R <u> </u>	
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	
	S <u> </u> T <u> </u> R <u> </u>	

COMMENCING YEAR 2000
RECEIVED FOR RECORD
CLINTON COUNTY, MICHIGAN

00 DEC 22 PM 3:26

L.C. Records: L. 8, P. 315
William A. Pisoni
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

West Meander Corner Between Sections 17 and 20, T43N, R31W

I, Gary L. Pisoni, in a field survey on December 1, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on July 14, 1849 by John Burt, U.S. Deputy Surveyor.

Original Corner: Cedar Post

Original Bearing Trees:

Cedar	18"	N 55° W	32 links (21.12 feet)
Cedar	12"	S 41° W	30 links (19.80 feet)

On 5/2/74, Arthur O. Enger, RLS DNR re-established the meander corner position by setting an auxiliary meander corner on line between the Northwest corner of Section 20 and the North quarter corner of Section 20; set a 1" diameter by 36" long iron pipe with a 3 3/4" diameter aluminum cap stamped as follows: T43N, R31W, Aux. M.C., S-17, S-20, 5/2/74, RLS 13581
No bearing trees found.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.

Found monument as described above.

Corner located on the West bank of the Michigamme River (now a pond) and is 54' from waters edge. Actual river is approximately 500' East, river was relocated around 1900.

Corner record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Blazed and scribed the following new bearing trees: (all measurements taken to a nail in side of tree)

Red Pine	17"	S 07° E	35.71 feet
Red Pine	14"	N 87° W	60.16 feet
Red Pine	13"	N 47° W	20.85 feet
Steel sign post		West	0.8 feet

00-083

Signed by

Gary L. Pisoni

Date

12-19-2000


Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

27457 REVISED MAY 14, 1976

REVISED JAN., 1983

REVISED OCT., 1995

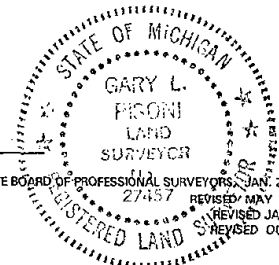

LIBER

8 PAGE 315