1993

COMMISSION

Property in Sec.

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

IRON COUNTY
MICHIGAN
RECEIVED FOR RECORD

REGISTER OF DEEDS

93 DEC 29	PH 2:	21	
L.C. RECOR	15 L	6 f.	300
Gillen	Sin	الأذا	

For corners in		<b>5</b>			
Iron  County		Located In:	Corner Code ##		
1.	Public Land Survey	T <u>43N</u> R <u>33W</u> T R	I=3		
		T R			
2.	Property Controlling	S T R			
3	in Section Miscellaneous	\$ T R S			

Register of Deeds Stamp & File Number


4. Lot No. \_\_\_\_\_\_, Recorded Plat \_\_\_\_\_\_

5. Private Claims \_\_\_\_\_\_

## Section Corner 3-2-10-11 T43N R33W

I, <u>Gary II. Pisoni</u>, in a field survey on <u>December 20</u>, 19 <u>93</u>, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

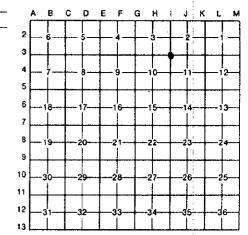

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Guy H. Carleton, U.S Deputy Surveyor in 1851. Original corner: Wood Post Original bearing trees:

No bearing trees recorded in original GLO notes.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original corner or bearing tree remains. Corner position found marked by an  $1\ 1/4"x24"$  iron pipe located on a rock fence line running North and East. Corner position has been used and accepted as the corner locally, for many years. Layed iron pipe next to aluminum monument as described below. Monument is 3" above ground surface.

This corner is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position, I set a 2" diameter by 30" long split base aluminum pipe monument with a 3" cast aluminum cap, stamped to read: Iron County Remonumentation, T43N, R33W, S-3, S-2, S-10, S-11, 1993, R.L.S. 27457; from which I established the following new blazed and scribed bearing trees: (all measurements taken to a nail of M 30 of M

of	tree)				_		
	Sugar	Maple	:	6"	N 64°E	18.94	feet
	Sugar	Maple		8 n	S 69 <sup>O</sup> E	10.74	feet
	Sugar	Maple		9"	S 33°E	38.01	feet
	Sugar	Maple	ı	7"	и 31 <sup>0</sup> w	9.97	feet
	Steel	sign post			South	0.99	feet

Signed by Lang J. Form

Date 12-28-73

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975

GARY L.
PISONI
LAND
SURVEYOR
NO.
27457

REVISED JAN., 1983

LIBER 6 PAGE 30(