

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

KALKASKA

Located In:

Corner Code #

(County)

2000 REMONUMENTATION

1. Public Land Survey

T 25N R 5W

A-9

T 25N R 6W

M-9

T R

T R

2. Property Controlling  
in Section

S

T R

S

T R

3. Miscellaneous  
Property in Sec.

S

T R

S

T R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

SURVEY &  
REMONUMENTATION

FEB 26 2001

SECTION

I, EUGENE FARRIER, in a field survey on December 12, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5			4		3		2		1
3													
4	7		8			9		10		11		12	
5													
6	10		17			16		15		14		13	
7													
8	19		20			21		22		23		24	
9													
10	30		29			28		27		26		25	
11													
12	31		32			33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

A-9: Sec. Cor. Common to Secs. 19 & 30, T25N-R5W, Garfield Township; M-9: Secs. 24 & 25, T25N-R6W, Garfield Twp.

1839, G.L.O. Resurvey, by James H. Mullett, set post for corner; beech 12" 529°W 46 Links; beech 10" N 66°W 65 Links; also used in 1852 Resurvey by Geo. M. Cannon; hemlock 14" N 47° E 26 links, beech 8" 554° E 27 links.

1976, LCRC 1976 Norman Parker Liber 2 Page 3; Found spike, placed 1/2" X 18" iron cap #16939; found bolt and washer NE side PP, 544°E 46.35'; set PK nail face of 10" N Pine n55°E 48.80'

1990, LCRC Robert Mitchell Liber 2 Page 408; found 1/2" iron and cap #16939; 535°E, 10" Maple, 63.82'; S 40°W, 8" T. Ironwood, 88.45'; N 19°E, 14" Red Pine 68.06'; N 58°E, 14" Red Pine, 68.72'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-9: Sec. Cor. Common to Secs. 19 & 30, T25N-R5W, Garfield Township; M-9: Secs. 24 & 25, T25N-R6W, Garfield Twp.

Found 1/2" iron in Mon.Box; same as LCRC, Norman Parker, Liber 2 page 3 and LCRC, Robert Mitchell, Liber 2 page 408

No G.L.O. witnesses were found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-9: Sec. Cor. Common to Secs. 19 & 30, T25N-R5W, Garfield Township; M-9: Secs. 24 & 25, T25N-R6W, Garfield Twp.

Found 1/2" iron in Mon.Box in centerline of N-S and E-W roads. Added brass cap.

S40°E 46.35' nail in power pole found.

S45°W 88.36' set nail and washer in 5" Tw Ironwood

N45°W 46.55' nail in wood post found

N 58°E 47.38' nail in 14" Red Pine found

Kalkaska County Peer Group accepted the above monument as the best available evidence of the position of the original corner.

Ratified by Peer Group

P.A. 345 - 1990 Kalkaska County


Chairman

Date 2-14-01

Signed by

Surveyor's Michigan License No. 24594

Date 2-15-01

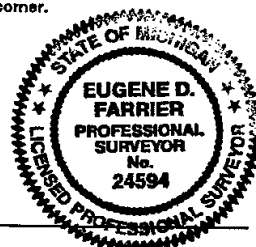

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 26, 1971

REVISED MAY 14, 1975

REVISED JAN., 1982

REVISED OCT., 1986



Kalkaska County Joan Hall, Register

3026815

Page: 1 of 1

02/16/2001 10:28A

REMON

LB: 6 PG: 144