

SURVEY &
REMONUMENTATION

APR 28 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970.

For corners in

Keweenaw

(County)

Located In:

Corner Code #

1. Public Land Survey

per C-5
T 57N R 32W
T 57N R 32W

C-5

C-4

2. Property Controlling

S T R

in Section

S T R

3. Miscellaneous

S T R

Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

REGISTER'S OFFICE

County of Keweenaw } SS

Received for Record, the

day of December A.D. 1994

at 2:00 o'clock P.M., and Recorded

in Liber 127 of LCR

on page 127

John I. Haataja
Register of Deeds

Register of Deeds Stamp & File Number

I, John I. Haataja, in a field survey on November 21, 1994

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-5 Section Cor. 7,8,17 & 18, T55N-R32W

Orig. Notes: Wood post set for corner.

W. Pine 30" N 70° W 50 lks.

W. Pine 30" S 60° E 28 lks.

1 1/4" iron pipe set in place of wood stakes on 9/15/21 by F. W. Halsey and Joseph Allwin.

2" pipe per LCRI, Page 30 on 6/13/83.

C-4 1/4 Corner between Sec. 7 & 8

Orig. Notes: Wood post for corner.

Cedar 12" S 50° W 9 lks.

Cedar 10" S 70° E 2 lks.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-5 Section Cor. 7,8,17 & 18, T57N-R32W

Found 1 1/4" pipe pulled out. Restored corner from reference ties.

C-4 1/4 Corner between Sec. 7 & 8

Found 1 1/4" iron pipe as noted in Calumet & Hecla Mining Co. records and at location consistent with measurements to other corners. Restored corner at location of 1 1/4" pipe.

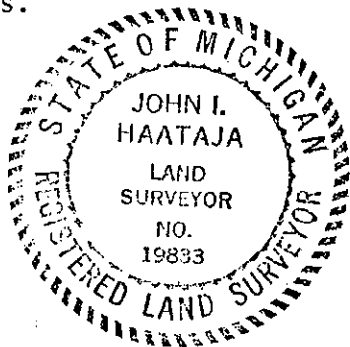

Ratified by Peer Group

In accordance with P.A. 345

Co. Rep. *James M. Haataja*

Date 11/16/94

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-5 Section Cor. 7,8,17 & 18, T57N-R32W

Set 1" pipe with brass cap as a careful and faithful perpetuation of the position of the original corner.

Utility Pole N 71° E 24.37'

18" Maple S 32° W 97.59'

6" B. Fir N 52° W 34.50'

10" H. Maple N 11° E 50.28'

C-4 1/4 Corner between Sec. 7 & 8

Cemented brass cap to 1 1/4" iron pipe as a careful and faithful perpetuation of the position of the original corner.

10" Y. Birch S 2° E 6.81'

12" Y. Birch N 10° E 7.13'

10" R. Maple N 77° W 27.72'

8" Cedar S 77° E 33.46'

Signed by *John I. Haataja*

Date November 23, 1994

Surveyor's Michigan License No. 19833