

'95 AUG 31 AM 11 24

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

KALAMAZOO

(County)

Located In:

Corner Code #

KALAMAZOO TWP.

1. Public Land Survey

T 2 R 11D1

T _____ R _____

T _____ R _____

T _____ R _____

2. Property Controlling
in Section

S _____ T _____ R _____


S _____ T _____ R _____

3. Miscellaneous

S _____ T _____ R _____

Property in Section

S _____ T _____ R _____



CLERK-REGISTER

LIBER

1 **1338**

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, GARY D. HAHN, in a field survey on APRIL 28, 19 95

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Corner not set during GLO survey.

1866 F. Stimson Co. Sur. "Made by bisecting sec. line". Beech 14 S68°W 75 Beech 8 S37½? 65
1878 E. Strong Dep. Sur. "Sug 3 S7°E 31 Stone Br Bisected Sec. line agreeing very nearly
with former survey.

1977 Allen McMachen RLS 16935 LCRC Liber 1, Page 727 "Mon. box"

1992 Thomas Chettleburgh RLS 16036 LCRC Liber 1, Page 965 "1 1/2" Iron Bar in monument box"

Nail SW side 16" Maple N22°W 27.76'

Nail SE side 12" Maple N53°E 29.33'

Nail SW side 20" Maple S34°E 33.65'

Nail NE side 23" Maple S5°E 26.32'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 2 1/8" square topped 18" long 1" dia. rod in mon. box.

Dug down 4' through clay and then dirt and gravel to sand. Did not find stone or brick.
Road appears to have been cut 2' - 3'.

RATIFIED
BY KALAMAZOO COUNTY
REMONUMENTATION
PEER GROUP
6-15-95



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D1, North Quarter corner Section-5, T2S, R11W, Ratified by Kalamazoo County Remonumentation Peer Group on June 15, 1995 as a closing corner. This position not established by original government surveyors. This monument (1" dia. rod) is accepted as the best available evidence of the position of the corner. Removed 1" dia. rod and replaced with a 20" Harrison Monument in mon. box.

Set P.K. nail in N. Face 6' Maple S42°W 35.34'

Fnd. cabin spike in 27" Maple S6°E 26.37'


Fnd. cabin spike in 21" Maple S40°E 33.68'

Fnd. cabin spike in 18" Maple N19°W 27.77'

Fnd. capped iron south 33.00' RLS 16036

Fnd. cabin spike in 14" Maple N48°E 39.38'

Signed by

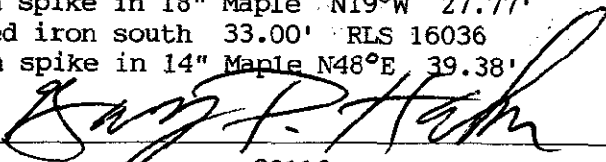

Date 8-30-95

Surveyor's Michigan License No. 38116