SURVEY & REMONUMENTATION

1	
11	

APR 27 1995

LIBER 1 PC1234

COMMISSION	LAND CORNER	RECORDATION	CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970


For corners in			
Kalamazoo (County)	Located In	: Corner Code ##	
Brady Township Dublic Land Survey	т <u>4 S</u>	R 10 W D-1	
	Τ :	R	
	T1	R	
	T1	R	
2. Property Controlling	S T	R	
in Section	S T I	R	
3. Miscellaneous	S T !	R	R
Property in Sec.	S T	B	1

STATE OF HIGHEAN COUNTY OF KALAMAZOO RECEIVED FOR KECORD 'S' DEG 30 AM 9 18

Register of Deeds Stamp & File Number

4.	Lot No	, Recorded Plat
5	Private Claims	

Robert E. Snell in a field survey on June 6 19 94 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

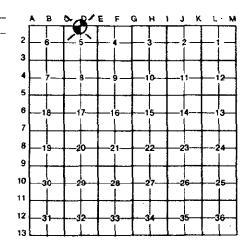

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
 This Position Not Established by Original Government Surveyors.
 - 1904: Ed Strong, County Surveyor; Set iron at 40 Lks East of South 1/4 Post for Section 32, Pavilion Township.
 - 1931: Wilkins & Wheaton Engineering Company; Used 26.40' East of South 1/4 Post for Section 32, Pavilion Township (no mention of found or set).
 - 1987: Ingersoll, Watson and McMachen; Set iron 26.40' East of South 1/4 Post for Section 32, Pavilion Township.
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 - 1994: Found 1/2" x 20" Iron at surface of Road. Believed to be set by Ingersoll, Watson and McMachen. Found 2 plow points below iron laying flat. Found another iron 3/4" in diameter below plow points.

RATIFIED
BY KALAMAZOO COUNTY &
REMONUMENTATION 2.
PEFF GROUP Q.
9-15-94

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 - D-1 North 1/4 Post Section 5, T. 4 S., R. 10 W., Ratified by the Kalamazoo County Remonumentation Program Peer Group on September 9, 1994. Found 3/4" iron below 2 plow points and iron, as set by Ed Strong in 1904 survey. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner. Removed iron at the surface and placed a 20" Harrison monument over 3/4" iron, placed plow points beside monument and placed a monument box over.

Notch in Top of Railroad Rail Fence Corner 02° North East 28° PK Nail in Northeast Side 45.12 East South 24° 66.921 Northeast Corner of House Foundation South West Northwest Corner of House Foundation 80.931 South West North 0.5

Center Line "T" Avenue North Center Line 27th Street West Date

0.5 12/28/94

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN.. 1983