

FEB 23 2001

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Luce County Remonumentation Corner

SECTION

For corners in

Luce County	Located in:	Corner Code #
1. Public Land Survey	T45N R10W	J-5
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No.	Recorded Plat	
5. Private Claims		

LUCE COUNTY
REGISTER OF DEEDS
Recorded

Liber 3 Page 967
02-12-2001 09:48:29

Kathy S. Mahar, Registrar
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on September 29, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

J-5 ¼ Corner Common to Sections 11 & 14, Town 45 North, Range 10 West.



- 1849 – Original corner established by William Ives was a 40" White Pine.
Witnesses: Cedar 6, N34°W 20 links – Hemlock 10, S30°E 19 links.
- 1985 – Eino Sainio, P.S. 7873, unrecorded survey shows the North ¼ corner of Section 14 midway on line between Section corners 2727.16 feet east and west.
- 1990 – Neil E. Hill, P.S. 27447, LCRC File No. 433, Luce County corner records. Reestablished corner midway on line between section corners east and west. Remains of an old east-west fence line on the north side of the old east-west road closely follows this line. Also found a concrete monument on the south side of the road bed southerly of this reestablished corner and a ½" iron rod in the center of the road bed southwesterly of corner. Mr. Hill states in part "A" of the LCRC that Mr. Sainio had noted that the existing monuments dated 16 Apr Set a ½" rod and cap #27447, 16 feet north of the existing trail centerline. Witnesses:
Found Concrete Monument, S05°39'E 31.48'
Found Iron in existing centerline of trail, S61°37'W 34.64'
M.D.O.T. tag in 13" Maple, N70°E 6.62'
M.D.O.T. tag in 9" Birch, N55°W 21.13'
M.D.O.T. tag in 6" Maple, 47.51'
- 1995 – Gary E. Keopke, P.S. 26458. Corner is shown on a survey recorded in Liber 1 of Surveys, page 145, same position as described by Mr. Hill in his 1990 LCRC, midway between Section corners 2627.24' east and west.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Luce County Remonumentation Program.
Found a ½" rod with cap #27447 and all witness objects as called for in the above mentioned 1990 LCRC.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found a ½" rod with cap #27447 at the corner location, which falls 16± north of an east-west trail.
Witnesses:
Found Concrete Monument, S05°39'E 31.48'
Found Iron in existing centerline of trail, S61°37'W 34.64'
M.D.O.T. tag in 13" Maple, N70°E 6.62'
M.D.O.T. tag in 9" Birch, N55°W 21.13'
Nail and plastic witness tag #33142 in 6" Maple, 47.51'

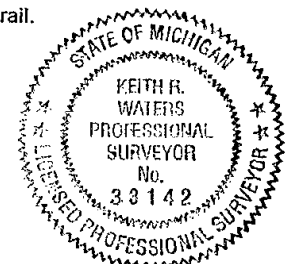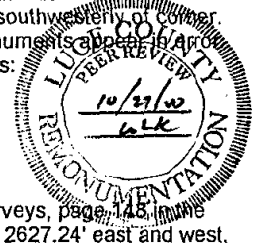

Signed by Keith R. Waters

Date 12-29-00

Surveyor's Michigan License No. 33142