

SURVEY &
REMONUMENTATION

DEC 18 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MASON

(County)

Located In:

Corner Code #7

1. Public Land Survey T 20N R 17W H-7
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. , Recorded Plat
5. Private Claims

I, Kenneth L. Ross, in a field survey on MAY 05, 19 95
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- H-7 Sec. Cor., 13 & 24-20-17; 18 & 19-20-16
1837 Mullett & Brookfield
(1) 10" Beech S 64 W 27 lks
(2) 8" Beech N 34 W 50 lks


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- H-7 Sec. Cor., 13 & 24-20-17; 18 & 19-20-16
Feb., 1989, M.D.O.T. Fd. 3/4" Pipe in Mon. Box, 1'
W Ex. US 31 CL (Job No. 26668)(filed Act 74 Liber
2, Page 196)
(3) N 40 E 52.80' 8" Elm
(4) S 70 E 48.77' 9" Scotch Pine
(5) S 30 E 55.91' Tele. Pole
(6) S 75 W 81.50' 2" Blue Spruce
Sep., 1966, Stephens Fd. 60d spike
(7) S 55 W 49.93' Road Name Sign
(8) S 35 E 55.10' Guy Pole # 421
(9) Due E 35.28' Fence Cor.
Nov., 1976, Ross Fd. Iron in mon. box
Dec. 1976, Ross used corner in survey

- Jun., 1977, Nordlund used corner in survey (Liber .
1 R.C.S., Page 456)
Oct., 1977, Ross used corner in survey
Dec., 1987, Ross Fd. Iron in mon. box
Sep., 1989, Slawinski used corner in survey (Liber.
385, Page 327)
Oct., 1991, Slawinski used corner in survey (Liber.
418, Pages 967 & 968)
Apr., 1994, Ross Fd. Iron in mon. box
May, 1995, Ross Fd. corner destroyed by road
reconstruction. Corner position restored by
reconstruction of M.D.O.T. control survey using
surrounding section corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- H-7 Sec. Cor., 13 & 24-20-17; 18 & 19-20-16
No witness from above found
Set 5/8" X 24" rebar with 2 1/2" alum. cap in mon.
box, 1.4' W of CL US31 and 3.5' N of CL Treml Rd,
and is accepted as the best available evidence of
the original corner.
S 78 W 168.79' Power Pole
S 40 W 147.83' NE Cor. Hse.
S 82 W 94.74' 12" Red Pine
N 53 W 150.38' Power Pole

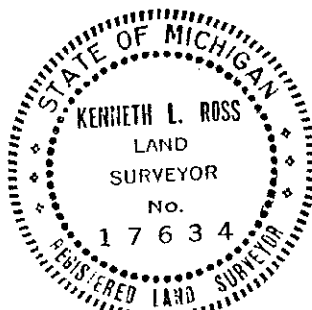

Peer Group Reviewed
and Approved
Date: 6-14-95
Kenneth L. Ross
Mason County Surveyor

Signed by Kenneth L. Ross

Date 6-14-95

Surveyor's Michigan License No. 17634