

JAN 20 2000


SECTION

MONTCALM COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Montcalm
(County)

Located in:
Cato Township

Corner Code #

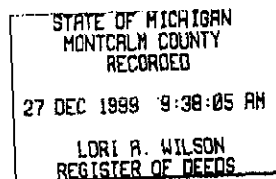

Register of Deeds Stamp & File Number

1. Public Land Survey Sec. 4 T12 N R 08 W F-03
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

I, William G. Tingley, in a field survey on July 14 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
November 15, 1838, Noah Brookfield Deputy Surveyor, GLO notes page 332
East random between 4 & 9, West corrected between 4 & 9, Set quarter Section post in treeline

Beech 24" N39°W 53 links
Beech 14" S60°W 15 links

No Date, Note Card

1/4 PO 4-9
Beech 24" N39°W 53 links
Beech 4" S60°W 15 links

1869 NCBT's Hemlock 22" N43°E 24 links
1906 Drove gas pipe Popular 7" S47 1/4°E 52 1/4 links
Popular 10" S62°E 72 links

1939 R.D. McNutt Iron Pipe

1940 Maple SW 42.0'
Apple SW 53.0'
Apple NW 54.5'

April 20th, 1972, D. Scott LCRC Liber 001 Page 007 & 008

Found Monument Box in road intersection with 2" pipe in box

Tele. Pole S30°E 59.4'
Buried cable marker S66°E 67.5'
Stop sign N70°E 68.5'
Road name sign N50°W 30.0'
Apple tree S84°W 54.6'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Searched at apparent location of the corner and found 2.5" x 1.25" iron pipe 0.25" below the surface, over a 1.0" x 1.9" solid iron 0.65" below the surface.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Set standard remonumentation pipe

(M) Measured (R) Recorded

Stop sign
Apple tree (dead)
Set nail and tag NE side 12" Maple
Set nail and tag SW side Power Pole
T/C Tele. Riser Box

(M) N70°E (R) N70°E
S80°W S84°W
N50°W
S63°W
N37°E

(M) 68.60' (R) 68.50'
54.40' 54.60'
47.55'
67.65'
55.20'

This corner is accepted as careful and faithful perpetuation of the position of the original corner.

Signed by William Tingley Date 22/07/99, 1999
Surveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 25, 1971
REVISED MAY 14, 1975
REVISED JAN., 1993
ADAPTED FOR WORD PROCESSING MARCH, 1993



LIBER 4

PAGE 191