

SECTION

MONTCALM COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Montcalm

Located In:

Corner Code

#

(County)

Reynolds Township

1. Public Land Survey	Sec	T	R	W	
	25 & 36	12N	10		L-11
		T	R		
		T	R		
		T	R		
2. Property Controlling	S	T	R		
in Section	S	T	R		
3. Miscellaneous	S	T	R		
Property in Sec.	S	T	R		

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, William G. Tingley a field survey on May 29, 1999,
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded
on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

1837, John Hodgson, Deputy Surveyor, GLO, page 407.

West corrected between Section 25 & 36 set quarter section post 39.87

Swamp Ash 10" N10°E 12 links

Swamp Ash 8" S11°W 19 links

1894, December, J.E. Youdan, County Surveyor, (Notes from back of Red Field Book at Montcalm County Court House)

25 and 26, East Boundary Drove Well point

End post of fence S85°W 25 links

June 15, 1982, G. Hackbardt, #25844, Liber 2, Page 10.

Found well point in fnc. & tree row, field sep. to east.

Maple 12" North 4.4 feet

Hickory 7" N5°E 9.1 feet

April 6, 1995, W. Tingley, #30104, Sec ¼ corner section 25

Found well point

12" Maple North 4.4 feet

7" Hickory N5°E 9.1 feet

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found well point 0.8' above surface in North/South fencerow, 30 feet North of field separated to the East.

Found 13" Maple Stump North 4.4 feet

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set Remonumentation Monument over 1 5/8" well point at ground surface.

Found Nail NW side 8" Hickory S70°W 5.52 feet

Set nail and tag West side 6" Cherry S5°W 20.7 feet

Set nail and tag NE side of 10" hickory N10°W 53.9 feet

Set Witness marker East 6.24 feet

This corner is accepted as a careful and faithful perpetuation of the position of the original corner

Signed by

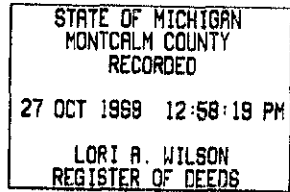
William Tingley

Date

8/18

, 1999

Surveyor's Michigan License No.

30104

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER
GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN
PUBLIC ACT 345 OF 1990 AT A MEETING HELD 8/18/99

WGT
William Tingley, PS, Chairman

