

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Marquette

(County)

Located In:

Corner Code #

1. Public Land Survey

T	R	
T	R	
T	R	
T	R	

2. Property Controlling in Section

S 35	T 49N	R 28W	1
S 35	T 49N	R 28W	7

3. Miscellaneous Property in Sec.

S	T	R	
S	T	R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Jan 31 2002

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5			4		3		2		1	
3													
4	7		8			9		10		11		12	
5													
6	18		17			16		15		14		13	
7													
8	19		20			21		22		23		24	
9													
10	30		29			28		27		26		25	
11													
12	31		32			33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(1-Sec. 35) West 1/16 corner between Sections 26 and 35. Corner not established in the original survey.
(7-Sec. 35) North 1/16 corner between Sections 35 and 36. Not established in the original survey. Found no record in Marquette Co. LCRCs. The POB of ASSESSOR'S PLAT NO. 24 OF DEAD RIVER BASIN is presumed to be intended to occupy the position of this corner, based on the measurements shown on the face of the plat. The plat shows distances south to 1/4 corner = 1308.15', north to section corner = 1308.15', north to Point "A" = 387.43'.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(1-Sec. 35) Found 1/2" rebar with plastic cap #25833, Larry Bussone PS, at the proper position, midway between Section and Quarter corners. Accepted same as a careful and faithful establishment of the position of the corner. Left the monument in place.
(7-Sec. 35) The monuments described on the face of the plat were all recovered. Determined that the POB of said plat is not monumented in accord with the dimensions shown on the plat, it being N17E 1.93' from the position subsequently monumented. From the plat POB, I found distances as follows: South to quarter corner = 1310.22', north to section corner = 1306.52', North to mon. at Point "A" = 385.85'. I established the corner midway and on a line of mean true bearing between Section corner 1308.37' north and Quarter corner 1308.37' south.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(1) Found 1/2" rebar with plastic cap #25833. Did not make witnesses to the monument during this survey.

(7) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Blazed and scribed:
11" dbl W.Spruce N40E 17.2' "1/16S BT"
6" Maple S67E 11.6' do
7" W.Spruce S33W 25.7' do
8" W.Spruce N31W 32.4' do
Set squared cedar post adjacent.
Bearings are magnetic. Distances are to notch in lower blaze.

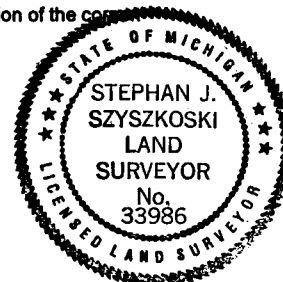

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 3/25/02