

FEB 08 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
MONTMORENCY COUNTY
Recorded & Filed

11-12-1999 09:25:23

TERESA WALKER
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

For corners in
MONTMORENCY

Located in:

Corner Code #

(County)

BRILEY TWP.

1. Public Land Survey

T 30N R 2 E K - 4

T R

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No. , Recorded Plat

5. Private Claims

I, DONALD E. MARLATT, in a field survey on JULY, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

K-4 1/4 COR. COMMON TO 11 & 12.

GLO CORNER SET BY LEWIS CLASON IN APRIL 1840. Y. PINE 14" N74°E 14 L., ASPEN 5" S30°W 23 L.

F. SMITH PS#754 NOTES-FROM LEROYS NOTES. THESE WERE THE NBTS SET 1883 FOR THE STATE ROAD SURVEY. NOR. STP 12" N 6 1/4°E 56 L., NORWAY STP. 14" N38 1/4°E 63 L. NO CORNER DESCRIPTION.

C.F. ROSER PS#12028 MSHD SURVEY APRIL 1965. SET 1"PIPE IN C/L OF M-32 IN LINE WITH FENCE SOUTH & OCCUPIED LINE TO NORTH. SW CORNER OF HSE N25°E 95.28', SE COR. OF HSE N45°E 108.67' N55°W 35"W.PINE 95.92'. IT FITS E-W 1/4 LINE TO WEST BY PLAT OF WEST ATLANTA L. 1, P. 69.

D.E.MARLATT PS#18660 ACT 132 DATED 9-2-81. L.3, P. 121. FD PK NAIL IN BLACKTOP. N25°E SW COR. OF HSE 95.28', N45°E SE COR. OF HSE 108.67', N55°W 35"W.PINE 95.92'

D.E. MARLATT ACT 132 DATED 8-9-36. FD. PK NAIL. SOUTH 33' 1/2"ROD & CAP, N55°W 36"W.PINE 95.92 D.E. MARLATT ACT 132 DATED 9-23-86. FD. PK NAIL(WITNESSES SAME AS ABOVE). NOT RECORDED.

D.E.MARLATT ACT 132 DATED 6-20-94. NO COR. DESCRIPTION. SW COR OF HSE N25°E 95.28', SE COR. OF HSE N45°E 108.67', 35"W.PINE N55°W 95.92', SOUTH 33' 1/2"ROD & CAP. NOT RECORDED.

D.E.MARLATT ACT 132 DATED 7-9-94. (WIT. SAME AS ABOVE). NOT RECORDED. (L.10004,P. 547)

D.E. MARLATT ACT 132 DATED 8-21-96.(WIT. SAME AS ABOVE WITH ADDITION OF NORTH 33' 1/2"ROD & CAP C. LINDGREN ACT 74 DATED 2-4-96. L.00001,P. 0519. FD. 1 1/2"PIPE IN MON. BOX AFTER CONST.

IN ORIGINAL POSITION. S 5°E 44.82' 16"TW MAPLE, S51°E 71.65' 10"W.PINE, N77°E 102.29' P.POLE, N63°W 95.92 48"W.PINE, SOUTH 116.79' CONC. MONUMENT. (P.S. # 14098).

B. Description of cor. evidence found and/or method applied in restoring or reestablishing corner. K - 4 1/4 COR. COMMON TO SEC.S 11 & 12. FD. 1"PIPE IN MONUMENT BOX. N77°E 102.29' P.POLE, N63°W 95.92 48"W.PINE,SOUTH 116.79' CONC. MON., SW COR. OF HSE N25°E 95.28', SE COR. OF HSE N45°E 108.67'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: (ALL RECORD WITNESSES)

K - 4 1/4 CORNER COMMON TO SEC.S 11 & 12.

PLACED 1/2"ROD AND REMON. CAP IN 1"PIPE IN MONUMENT BOX.

N77°E 102.29' P.POLE-SPIKE & PS TAG 18660

N63°W 95.92' 48"W.PINE -SPIKE & PS TAG 18660.

SOUTH 116.79' CONC. MONUMENT


SW CORNER OF HSE N25°E 95.28'

SE CORNER OF HSE N45°E 108.67'

APPROVED BY
PEER GROUP

JUL 20 99

L.A.B.

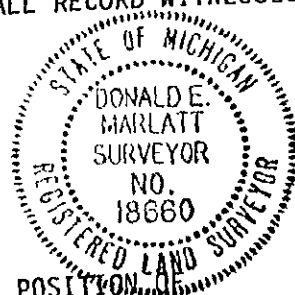

APPROVED BY PEER GROUP JULY 20, 1999 AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Donald E. Marlatt
Surveyor's Michigan License No. 18660

Date 11-8-99