

NEWAYGO COUNTY
REGISTER OF DEEDS
MARLENE TOOGOOD

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970 JAN 21 PM 3 24

For corners in
Newaygo

(County)

Located In:

Corner Code #

1. Public Land Survey

T 11N R 12W

C-2

T R

T R

T R

T R

2. Property Controlling

S T R

in Section

S T R

3. Miscellaneous

S T R

Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

Marlene Toogood
VOL 001 PAGE 05

Register of Deeds Stamp & File Number

I, Norman L. Ochs, in a field survey on December 10, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

W. 1/4 Corner, Section 5, Grant Twp., Newaygo Co., Mich.

A. Description of original monument and accessories and/or subsequent restoration:

10-31-1886 N. Brookfield 1973 Patrick A. Salisbury and 1978 found
18" Pine N80°W 32ls. (21.12') #1 R.L.S. #13594 L.C.R.C. #351
12" Pine S41°E 42 lks. (27.72') #2 5/8" Twist Rerod raised w/
1 1/4" pipe.

1931 Lyle S. Shepherd's Book

Pine Stump S41°E 27.72' #2

Tw. B. Oak N80°W 35' #3

P. Pole N88°30"E 79.42' #4

8" Oak S59°W 37.40' #5

Sw. Cor. Hse. Fnd. S51°E 141.23' #6

1978 N.C.R.C. 1/2" iron 40" B. Oak N78°W 41.3' #7

12" B. Oak S61°W 40.8' #5 P. Pole N87°E 79.5' #4

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

In 1973 Patrick A. Salisbury broke the NW. 1/4 of Sec. 5. He found a 5/8" Twist rerod 16 inches down, and raised with a 1 1/4" pipe. He measured 2626.73' from the W. 1/4 Cor. to the NW. Cor. and measured 2760.05' from the W. 1/4 Cor. to the C. 1/4 Cor. In 1978, I, Norman L. Ochs, found the 1 1/4" pipe in the centerline of road West. on Line with woodline going East. In 1982 and 1984 Charles E. Fricke found a pipe. I, Norman L. Ochs, found a 1 1/4" pipe and replaced with a 4" Harrison Cast Iron Monument, on Dec. 10, 1993

Condition of recorded witnesses is: #1 Gone #2 Gone #3 Gone #4 Good Condition #5 Stump #6 Good Condition #7 thru #10 Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted 4" Harrison Cast Iron Monument as a substantial marker for the 1/4 Corner and is accepted as a careful and faithful reestablishment of the original corner.

SW. Cor. House Foundation S51°E 141.30' #6

P. Pole East 79.47' Spike in the South side of pole #4

8" W. Pine N25°E 80.88' spike in the West side of tree

12" W. Pine N45°W 40.67' spike in SW. side of tree

SEE OVER-----

5-17-82 Charles E. Fricke
R.L.S. #21781
Recorded in Series M No. 6323
6" Tw/ Oak East 36.95' #8
12" Oak WSW 33.90' #9
4" Pine WNW 21.90' #10

Signed by

Norman L. Ochs


Date

December 27, 1993

Surveyor's Michigan License No. Norman L. Ochs R.L.S. #22439

Approved by Peer Review Group December 27, 1993

Norman L. Ochs, County Representative

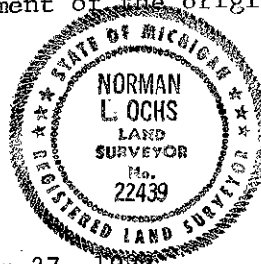

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971
REVISED MAY 14, 1979
REVISED JAN., 1983

SURVEY &
REMONUMENTATION

DEC 07 2000

SECTION

A. Continued.....
Charles E. Fricke R.L.S. #21781
Recorded in Series P No. 3643
P.Pole N88°30'E 79.42' #4
8" Oak S59°W 37.40' #5
SW. Cor. Hse. End. S51°E 141.23' #6

SURVEY &
REMONUMENTATION

DEC 07 2000

SECTION