

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

MAR 02 2001

SECTION

For corners in

Ontonagon County

Located in:

Corner Code #

1. Public Land Survey

T48N R39W M-13
T48N R38W A-13
T47N R39W M-1
T47N R38W A-1

2. Property Controlling
in Section

S T R
S T R

3. Miscellaneous
Property in Sec.

S T R
S T R

4. Lot No.

Recorded Plat

5. Private Claims

JUDITH D. ROEHM

Ontonagon County

1P

Page 1 of 1

JEM Date 01/03/2001

LC 5/372

RECORDING FEE:

Time 14:40:20

9.00

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, Joseph C. Domitrovich, in a field survey on September 12, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(M-13) Township Corner - Common to Sections 36, T48N, R39W, Section 31, T48N, R38W, Section 1, T47N, R39W, Section 6, T47N, R38W.

1847 - Austin Burt set a Hemlock post with ties:

14" Yellow Birch S 25°W 64 links
24" Hemlock N 54°E 31 links

1964 - Michigan State Highway Department, M-28 Highway Plans show this corner as being a 3/4" re-rod with ties:

Power Pole S 20°W 34.08'
4" Poplar N 45°W 34.58'
6" Poplar N 65°E 37.20'

They also gave distances East to Centerline M-28, and North to the NE corner of Section 36, T48N, R39W.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. The corner now falls at a 4-way intersection with county roads running N, S & W and a 2-track East. The area around the corner has been cut substantially and the only remains of the Highway Department's corner is the power pole bearing object which is now a sawed off section. Holding the power pole, record distance to centerline and record distance to the section corner to the north I was able to recreate the position of the Highway Department corner. I have accepted that position as the true section corner and have Monumented it.

Research on file with County Remonumentation Representative.

DEER GROUP APPROVED


Carl W. Applekamp

COUNTY REGISTERED 12-19-00

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 5/8" x 24" iron pin with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T48N, T47N, R38W, R39W; S. 1, S. 6, S. 31, S. 36; 2000; P.S. 37273. I also established a reference monument, (R.M.) to the Northwest, a 2 1/2" x 30" aluminum pipe with a 3" diameter cap stamped to read that the section corner is S 27°E, 50.67 feet. Corner falls 4' West of the West Edge of Pavement of N-S county road and on centerline of county road to West and 2 track to East. Ties:

Metal "Haight Rd." sign N 23°W 49.43'
Twin 10" Hard Maples N 66°E 75.44'
6" Poplar S 57°E 72.49'
New Power Pole S 32°W 35.80'
R.M. N 27°W 50.67'

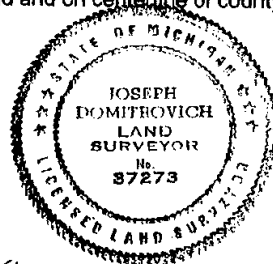

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted. Bearings shown between corners are on assumed basis, for reference only.

Signed by Joseph C. Domitrovich

Date 12/19/00

Surveyor's Michigan License No. 37273