

**MAR 02 2001**

**LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

**SECTION**

For corners in

Ontonagon County

Located in:

Corner Code #

1. Public Land Survey

T48N R41W B - 11

T R

T R

T R

2. Property Controlling  
in Section

S

T R

S

T R

3. Miscellaneous  
Property in Sec.

S

T R

S

T R

4. Lot No. , Recorded Plat

5. Private Claims

**JUDITH D. ROEHM**

Ontonagon County

LC 5/358

Page 1 of 1

JEM Date 12/08/2000

Time 11:43:30

RECORDING FEE:

9.00

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6	5			4		3		2		1	
3													
4		7	8			9		10		11		12	
5													
6		18	17			16		15		14		13	
7													
8		19	20			21		22		23		24	
9													
10		30	29			28		27		26		25	
11													
12		31	32			33		34		35		36	
13													

I, Joseph C. Domitrovich, in a field survey on November 3, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(B - 11) ¼ Corner Common to Sections 30 & 31, T48N, R41W.

1851 - Wells Burt set ¼ section post with ties:

12" Cedar	S 45°W	8 links
16" Y. Birch	S 60°E	10 links

I found no record of Subsequent restoration.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. Area around the corner has been heavily logged and no evidence whatsoever of the corner was recovered. I treated the corner as lost and re-established it by single proportionate measurement. Distances work well with GLO.

Research on file with County Remonumentation Representative.


**DEER GROUP APPROVED**

*Earl W. Hyslop*  
COUNTY REMONUMENTATION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: 11-29-00

Corner is a 3" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T48N, R41W; ¼; S. 30, S. 31; 2000; P.S. 37273. Corner falls 36' East of Middle of Logging Road. Ties:

4" Poplar	S 53°W	9.22'
16" Spruce	N 02°W	8.62'
10" Spruce	S 87°E	27.22'
Steel Sign Rail	S 35°E	0.57'
NW Cor. Sec. 31	N 89°40'18"W	2478.61'
NE Cor. Sec. 31	S 89°40'18"E	2643.84'

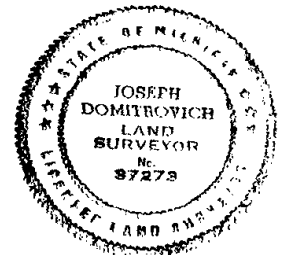

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted. Bearings shown between corners are on assumed basis, for reference only.

Signed by

*J. C. Domitrovich*

Date

11/07/00

Surveyor's Michigan License No. 37273