9.00

LAND CORNER RECORDATION CERTIFICATE Ontonagon County LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P. 124 1970 1 1
Filing Requirement of Act 74, Mich. P. 124 1970 1 1

LC 5/284 Time 16:29:04

RECORDING FEE:

For corners in

Ontonagon County

Located in:

Corner Code #

T52N R39W 1. Public Land Survey R T T R R T T R 2. Property Controlling S R T S in Section T R S Miscellaneous

SURVEY & PEMONUMENTATION

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number

4. Lot No.

. Recorded Plat

S


5. Private Claims

Property in Sec.

I, Joseph C. Domitrovich, in a field survey on May 11, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above requirements of the United States Department of the Interior, Bureau of Land Management or survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

R

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

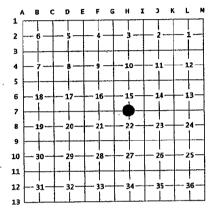

A. Description of original monument and accessories and/or subsequent restoration:

(H - 7) 1/4 Corner common to Sections 15 & 22, T52N, R39W.

1845 - William A. Burt set Sugar Post with ties:

14" Sugar

N 23°W

26 links

12" Yellow Birch

N 52°E

12 links

1920 - E.J. Donnelly, C. E., set a pin by proportionate Measurement in Centerline of road.

1989 - Robert Mick, P.S. 16936, recorded this corner in Liber 3, p. 78 of Corner Records. He re-established this corner at GLO distance from creek crossing. He set a 1 ½" PK nail and added three new bearing objects. Ties:

Power Pole	N 55°W	54.55'
10" Spruce	S 37°E	53.40'
4" Cherry	S 21°E	35.75'
7" Sugar	S 20°W	46.40'

PEER GROUP APPROVE COURT

> JOSEPH DOMITROVICH LAND SURVEYOR 37273

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

I found no remains of the original corner or accessories. E.J. Donnelly's iron pin and Bob Mick's P.K. nail have been destroyed by extensive road reconstruction. All four of Mick's bearing objects are remaining. I re-established a position for Mick's P.K. Nail from the average of his distances from recovered Bearing Objects. This position works reasonably well with GLO distances to Section Corners East and West: SW Corner Section 15, N 89°55'42"W 2632.50' measured, 2645.28' GLO; SE Corner Section 15, S 89°59'59" 2662.60' measured, 2645.28' GLO. I accepted the recreated Mick position as the ¼ corner. Corner falls 1' North of Centerline of County Road.

Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

Corner is a 5/8" x 24" rebar with 3" diameter aluminum cap placed on it stamped to read: COUNTY REMONUMENTATION, T52N, R39W; S. 15, S. 22; 1/4; 2000; P.S. 37273. I also established a reference monument to the North, a 2 1/2" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to indicate that the 1/4 corner is S01°19'W, 37.28'. Distances to bearing objects are EDM - reduce to Horizontal. Ties:

R.M. *12" Balsam* 7" Cherry 10" Hard Maple	S 35°E S 20°E S 22°W	52.42' 35.51' 47.31'	(Existing Nail & Blaze) (Existing Nail & Blaze) (Existing Nail & Blaze) (Existing Nail & Blaze)
Power Pole	N 54°W	54.17'	(Nail & Cap #16936 in side)

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by