9.00

LAND CORNER RECORDATION CERTIFICATE Ontoneson County

Filing Requirement of Act 74, Mich. P.A:4970of 1

JEM Date 07/10/2000 RECORDING FEE:

LC 5/315 Time 12:13:37

For corners in

Ontonagon County Located in: Comer Code # 1. Public Land Survey T52N R39W I - 13T R Т R Т R 2. Property Controlling R T in Section Ť S R 3. Miscellaneous S Ť R Property in Sec.

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION


Register of Deeds Stamp & File Number

, Recorded Plat Lot No.

5. Private Claims

I, Joseph C. Domitrovich, in a field survey on June 20, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

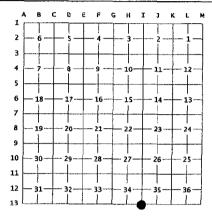

A. Description of original monument and accessories and/or subsequent restoration:

(I-13) Standard Corner Common to Sections 34 & 35, T52N, R39W.

'Note: Corner Not Common with Section to South.

August 1945 - William A. Burt set a fir post with ties:

22" Sugar

N 44°E

12 links

12" Hemlock N 17°W 27 links

September 1845 - Austin Burt (In T51N, R39W Subdivision notes) intersected 92 links (60.72') east of this corner and

set a post at the corner of Sections 2 & 3 (T51N, R39W). Ties to this post:

10" Hemlock

S 11°W

29 links

8" Fir

S 62°E

42 links 1923 - E.J. Donnelly, Reg. C.E. found what he originally believed to be the SE corner Section 34 and noted that the original notes were wrong. He found 2 B.T. stumps cut off above the iron marks but the blazes with the iron marks were on the wrong sides of the stumps. He found: 1.3" diameter Hemlock, \$ 10°W, 19' and 20"+ Maple, N 45°W, 72'. In a later note he recognizes that the corner he actually found was the closing corner set by Austin Burt in 1845. (See notes in original notes at the Ontonagon County Register of Deeds and Donnelly's map in bottom of the plat cabinet.) He also notes a distance west to a creek crossing and to the SW corner of Section 34, which verify that this was the closing corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: I found no remains of William A. Burt's post or accessories. I recovered a 5/8" square lightening rod at the closing corner referred to by E.J. Donnelly. (Same type of pin set by Donnelly elsewhere in this township.) I relied on this corner and the original GLO information to re-establish a position for the standard corner. This works well with corners to the North, East and West. yeeh growp arkm

Research on file with County Remonumentation Representative.

on was seen a

C. Description of monument for comer and accessories established to perpetuate locating the position of the comer: Corner is a 3/2" x 48" aluminum rod with a 3" diameter aluminum cap stamped to read: COUNTY

REMONUMENTATION; T52N, R39W; S. 34, S. 35; S.C.; 2000; P.S. 37273. Ties:

3" Balsam	North	32.40'
Closing Corner	N 89°32'54"E	60.72'
Southerly Power Pole	\$ 45°E	79.42'
Steel Sign Rail	West	0.65' (to face)
6" Balsam	N 28°W	39.98'
NE Cor. Sec. 34	N 00°10'08"E	5303.46' (5280' GLO)
S 1/4 Cor. Sec. 35	N 89°32'54"E	2623.70' (2640' GLO)
SW Cor. Sec. 34	\$ 89°54'20"W	5286.53' (5280" GLO)

OF BIENIA JOSEPH DOMITROVICH

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by _

Surveyor's Michigan License No. 37273