9.00

RECORDING FEE!

LC 5/316 Time 12:13:37

For corners in

Ontonagon County	Located in:		Corner Code #	
Public Land Survey		T52N T T T	R39W R R R	J-7
Property Controlling in Section	s s	T T	R R	
Miscellaneous Property in Sec.	S S	T T	R R	

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION


Register of Deeds Stamp & File Number

, Recorded Plat Lot No.

5. Private Claims

I, Joseph C. Domitrovich, in a field survey on June 16, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the comer points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

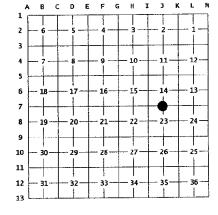

A. Description of original monument and accessories and/or subsequent restoration: (J-7) 1/4 Corner Common to Sections 14 & 23, T52N, R39W.

1845 - William A. Burt set a fir post with ties:

10" Sugar 8" Spruce

N 67°E N 65°W 3 links 13 links

1923 - E.J. Donnelly, Reg. C.E., on large drawing in the bottom of the plat cabinet at the Ontonagon Co. Register of Deeds, shows a distance of 2638.67' to this corner from Section corner to East and West but he does not say if he set something at the corner.

1955-57 - Ned Hawley, Timber Cruiser, noted in his copy of the original notes that he found a cedar stake down and marked a 7" Hemlock N 30°W, 5'. Later he drove a 1" x 5' pipe at this stake.

B. Description of corner evidence found and/or method applied in restoring or reestablishing comer: I found no remains of the original corner or accessories. I found the 1 1/4" O.D. iron pipe called for by Ned Hawley and his Hemlock B.T. Distances to section corners east and west work well but the pipe falls too far north. There is an old East-West roadbed 15' south of the corner, the centerline of which has been accepted as defining the section line for 21/2 miles, going west. I created a position for the 1/4 corner and holding the centerline of the old roadbed for the north south position and holding the Hawley pipe for the East-West position. This works well with section corners to the east and west. An old blaze on a 13" Cedar with "1/4 COR." written on it in pencil faces this position. I have accepted this position as the best representation of the true 1/4 corner.

Research on file with County Remonumentation Representative.

C. Description of monument for comer and accessories established to perpetuate locating the position of the corner: Corner is a 3/4" x 48" aluminum rod with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W; ¼; S. 14, S. 23; 2000; P.S. 37273. Corner falls in middle of old roadbed. Ties:

OF MICHIO JOSEPH DOMITROVICH LAND SURVEYOR 3727**3** CAND S'

13" Cedar Steel Sign Rail 6" Cedar 8" Cedar 6" Cedar 1 1/2" O.D. iron pipe SW Cor. Sec. 14 SE Cor. Sec. 14

N 31°F East S 54°E S 10°W S 42°W N 00°20'29"w

S 89°28'47"W

N 89°54'50"E

16.15' (Existing old Blaze) 0.53' 23.63 15.55' 23.42'

15.07

2643.19' (2638.67' Donnelly) (2637.36' GLO)

2631.50' (2638.67' Donnelly) (2637.36' GLO)

Note: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

6/21/00

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED JAM, 1975 REVISED JAM, 1976 REVISED JAM, 1976