

JUDITH D. ROEHM  
**LAND CORNER RECORDATION CERTIFICATE** Ontonagon County  
 Filing Requirement of Act 74, Mich. P.A. 1970 of 1

LC 5/318  
 JEM Date 07/10/2000 Time 12:13:39  
 RECORDING FEE: 9.00

For corners in

Ontonagon County Located in: Corner Code #

1. Public Land Survey		T52N	R39W	K - 7
		T	R	
		T	R	
		T	R	
2. Property Controlling	S	T	R	
in Section	S	T	R	
3. Miscellaneous	S	T	R	
Property in Sec.	S	T	R	
4. Lot No.				Recorded Plat
5. Private Claims				

**SURVEY &  
 REMONUMENTATION**

MAR 02 2001

**SECTION**

Register of Deeds Stamp & File Number

I, Joseph C. Domitrovich, in a field survey on June 15, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(K - 7) Corner Common to Sections 13, 14, 23, & 24, T52N, R39W.

1845 - William A. Burt set a cedar post with ties:

12" Cedar	S 63°E	30 links
18" Cedar	N 38°W	13 links

1920 - E.J. Donnelly, Reg. C.E., made notes in 3 places in the copy of the original notes at the Ontonagon Co. Register of Deeds, that the B.T. or B.T.s were still standing at this corner. He also notes in a large drawing which shows a number of corners throughout the township that there was a B.T. still here. (Drawing in bottom of plat cabinet at Ontonagon Co. Register of deeds.) He also shows distances from this corner to other corners to the west.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

The stump of the original 12" Cedar B.T. is now a 12" hollow stump with measuring notch plainly visible. The 18" Cedar B.T. is now fallen and almost completely decayed. I re-established the section corner at GLO calls from these two bearing trees. Distances to corners in all directions from this position work well.


Research on file with County Remonumentation Representative.

*FREE GROUP APPROVED*  
*Earl W. Applekamp*  
 COUNTY REMONUMENTATION 6-21-00

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 2 1/2" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W; S. 13, S. 14, S. 23, S. 24; 2000; P.S. 37273. Ties:

12" Hard Maple	N 78°E	7.10'
12" Cedar	S 18°E	14.81'
12" Hard Maple	S 45°W	23.78'
10" Hemlock	N 50°W	35.53'
Sign Rail	North	0.67' (to face)
E 1/4 Cor. Sec. 14	N 00°19'29"W	2642.90' (2640' GLO)
SW Cor. Sec. 14	S 89°41'47"W	5274.66' (5274.72' GLO) (5277.33' Donnelly)
SE Cor. Sec. 13	N 89°45'54"E	5245.12' (5264.16' GLO)

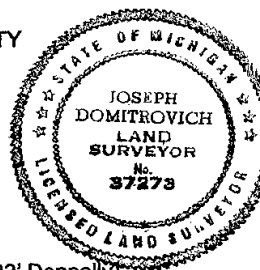

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by *Joseph C. Domitrovich*

Date 6/21/00

Surveyor's Michigan License No. 37273