JUDITH D. ROEHM

Ontonason County

Page 1 of 1 JEM Date 12/22/1999

10 5/271 Time 14:50:10

LAND CORNER RECORDATION CERTIFICATE NO FEE: Filing Requirement of Act 74, Mich. P.A. 1970

9.00

1P

I OI COILICIA II	For	corners	in
------------------	-----	---------	----

CNTONAGON (County)	Located In:	Corner Code #
1. Public Land Survey	T_49NR_ TR_ TR_	42W F-11
Property Controlling in Section Miscellaneous Property in Sec.	R S	

SURVEY & REMONUMENTATION

MAR 23 2000

SECTION


Register of Deeds Stamp & File Number

4. Lot No	, Recorded Plat	 	
5. Private Claims		 	

1 Corner common to Sections 28 & 33, T49N R42W.

[Earl W. Applekamp, in a field survey on Nov. 12 , 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

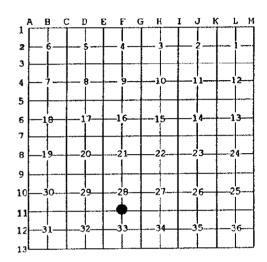

EARL W.

A APPLEKAMP
PROFESSIONAL
SURVEYOR

A. Description of original monument and accessories and/or subsequent restoration:

Original Corner established by William Burt, U.S. Deputy Surveyor,

June 13, 1848. Set Sugar Post.

ORIGINAL BEARING TREES:

10" Lynn 18" Y. Birch

S65°W

7 Links (4.62 Feet)

N65°E

24 Links (15.84 Feet)

In 1973 a drill steel was set at the intersection of a graded up road and a fence line running East & West to mark the 1 Corner. This was used for the South line of the Plat of "Leisure Acres" recorded in Liber 39, page 215 on March 26, 1974.

Description of corner evidence found and/or method applied in restoring or reestablishing corner: I found the 1" Drill Steel. The graded road has numerous trees growing on it. The fence line is all down. I accepted the 1" Drill Steel as being the only logical position for the corner, and monumented it as shown below.

Research on file with the Ontonagon County Remonumentation Program Representative.



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

C.	Description of monument for corner and accessories established to perpetuate locating the position of the corner 4. APPLEKAMP 4.4 PROFESSIONAL 2.2
	At the orner position I replaced the 1" Drill Steel with a $2\frac{1}{2}$ "X30" aluminum pipe with a 3" cap stamped to read: County Remonumentation T49N R42W, S28, S33, $\frac{1}{4}$, 1999, P.S. 17610. I established three bearing trees and a reference object. SURVEYOR No. 17610 OFESSION OFESSION
	Nail in 7" Maple N78°W 38.51' - Nail in 9" Maple S23°W 49.38' Nail in 12" Spruce S57°E 33.89' - 6' Steel Sign Post North 0.78'
	gned by Laul W applikary Date November 29, 1999 Inveyor's Michigan License No