

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Ontonagon County Remonumentation Corner

Ontonagon County

Section 1

LC

5/142

Date 08/26/98 Time 13:30

FILING FEE:

9.00

For corners in

Ontonagon County

Located in:

Corner Code #

1. Public Land Survey

T51N R37W

A-11

T51N R38W

M-11

T R

T R

2. Property Controlling
in Section

S

T R

S

T R

3. Miscellaneous
Property in Sec.

S

T R

S

T R

4. Lot No.

, Recorded Plat

5. Private Claims

I, Joseph C. Domitrovich, in a field survey on August 18, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(A-11) Corner Common to Sections 30 & 31, T51N, R37W and Sections 25 &

36, T51N, R38W

1845 - Austin Burt set post.

16" Sugar S 23° W 22 links

12" Sugar N 83° W 27 links

1957 - Michigan State Highway Department (M.S.H.D.), in M-26 and M-38 Highway plans shows a distance to the ¼ Corner to the West.

1976 - Keith Sackett, P.S. 19006, for Michigan DNR, found 1" I.D. iron pipe one foot above ground. He established 3 NBTs: 4" Ironwood S 04° W 13.6'; 6" Ironwood S 66° E 27.2'; 8" Sugar N 51° E 35.8'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. I found the pipe called for by Sackett and his 3 NBTs. Distances measured to the ¼ Corner and ridge calls to the North work well with GLO. Distance to the ¼ Corner to the East works reasonably well. Distance to the ¼ Corner to the South is nearly a chain short, and the distance to the ¼ Corner to the West is over 1 ½ chains long. This pipe, however, has been used and accepted by surveyors for many years and best represents the position of the original Corner. I therefore have accepted it as the Section corner.


Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 3/4" x 36" aluminum rod driven into a 1 1/4" O.D. iron pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; S.25, S.36, S.30, S.31; T.51N, R.38W, R.37W; 1998; P.S. 37273. The Corner falls on the Southerly edge of a cut for an old East-West road bed.

Witnesses:

10" H. Maple	N 53° E	36.22'	(DNR, added nail)
6" Ironwood	S 65° E	27.65'	(DNR, added nail)
14" H. Maple	S 22° E	12.26'	(old blaze, Dept. Cons. Poster)
4" Ironwood	S 06° W	13.85'	(DNR, added nail)
18" Y. Birch	S 71° W	20.82'	(M.S.H.D. tag & nail on side)
Steel Sign Rail	West	0.75'	(to face)
W ¼ Cor. Sec. 30, T51N, R37W	N 00°18'25" W	2638.39'	(2640' GLO)
S ¼ Cor. Sec. 25, T51N, R38W	N 89°25'34" W	2740.14'	(2740.28' M.S.H.D.; 2640.66' GLO)
W ¼ Cor. Sec. 31, T51N, R37W	S 00°19'44" E	2578.61'	(2640' GLO)
S ¼ Cor. Sec. 30, T51N, R37W	S 89°02'30" E	2760.25'	(2742.30' GLO)

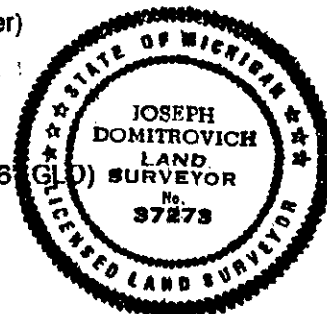

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by

J. C. Domitrovich

Date

8-19-98

Surveyor's Michigan License No. 37273