

# SURVEY & REMONUMENTATION

Approved by Alger County  
Land Survey Remonumentation  
Peer Group Under Act 345 of  
P.A. of 1990 On 5/8 1996

JUL 30 1996

## COMMISSION

### LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

4-374

For corners in  
Alger  
(County)

Located In:

Corner Code #

FILED  
TIME 3:00 p.m.

JUN 27 1996

DONALD W. KINNUNEN  
REGISTER OF DEEDS  
ALGER COUNTY, MI

Register of Deeds Stamp & File Number

1. Public Land Survey T 48N R 15W C4         
T        R         
T        R         
T        R
2. Property Controlling S        T        R         
in Section S        T        R
3. Miscellaneous S        T        R         
Property in Section S        T        R
4. Lot No.       , Recorded Plat
5. Private Claims

I, Robert L. Jamros, in a field survey on February 16, 1996, 19       ,  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned  
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current  
manual of survey instructions of the United States Department of the Interior, Bureau of Land  
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and  
5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a  
Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found  
as expressed below:

**NOTE:** Not more than 4 corners, all in the same town and range, may be recorded  
on this certificate.

#### A. Description of original monument and accessories and/or subsequent restoration:

C4: PLS-George E. Adair, DS, 1851, Set Qr. section post - Hemlock 13", N.64 E., 21 links, Hemlock 13", S.44 W., 47 links.\*\*\*\*\* Ray J. Brotherton, RLS, 1946, Set iron from GLO Hemlock BT's in NE and SW locations, both here in 1946. As noted in leather bound books of GLO field notes, Page 93, T.48N., R.15W., Alger County Records. No other subsequent restoration.

#### B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C4: Found a truck spring leaf with orange paint on top at corner position. Believed to be iron set by Ray J. Brotherton, RLS, in 1946. At GLO BT location N.64 E., 13.9 feet (21 links) found 24" hemlock dead, down and decayed. On Hemlock stump and downed stub, face area of GLO blaze and marks decayed to center. Also found twin six inch maple with eight tally marks painted (old) on it, East six feet more or less from corner position. Old paint lines extend North, West and South from corner position. Set monument at this position alongside spring leaf. Spring leaf position was set from original BT and is accepted as a careful and faithful perpetuation of the position of the original corner.

#### C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C4: Installed Berntsen Mon. No. A1NB30 on easterly edge of truck spring leaf, Stamped to identify corner position. Established reference tress w/ BT signs, blazed, scribed and painted. Set PK nails for measure w/ Alum. I.D. washers in the following reference trees. Maple 6", S.10 E., 4.61 feet, " 1/4s BT ", W.Pine 20", S.72 W., 42.54 feet, " 1/4s BT ", Maple 9", N.21 E., 23.40 feet, " 1/4s BT ", Maple 9", N.26 W., 24.46 feet, " 1/4s BT ", Survey marker sign on six foot steel post, Southeast 1.0 feet. All bearings are magnetic.

Signed by


Robert L. Jamros

Date

12 June 1996

Surveyor's Michigan License No.

25849

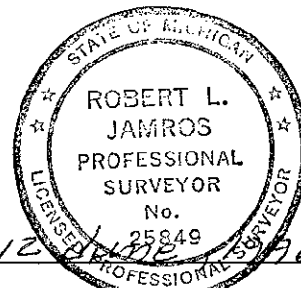

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983