

# SURVEY & REMONUMENTATION

FEB 23 1999

## SECTION

### LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

05-110

Approved by Alger County  
Land Survey Remonumentation  
Peer Group Under Act 845 of  
P.A. of 1990 On 12/16 1998

Chairman

For corners in

Alger  
(County)

Located In:

Corner Code #

1. Public Land Survey

T50N R13W

M 11-12 #1 ✓

T50N R12W

A 11-12

T R

T R

2. Property Controlling  
in Section

S

T R

S

T R

3. Miscellaneous

S

T R

Property in Sec.

S

T R

4. Lot No. , Recorded Plat

5. Private Claims

TIME 10:00 A.M.

JAN 8 1999

DONALD W. KINNUNEN  
REGISTER OF DEEDS  
ALGER COUNTY, MI

Register of Deeds Stamp & File Number

I, Robert L. Jamros, in a field survey on September 11, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M11-12: P.L.S. - John Burt, DS, 1841. Intersect Lake Superior. N. Pine 6, Meander Corner. N. Pine 9, S.18°E., 47 links, N. Pine 6, S.48°W., 43 links. \*\*\*\*\* Billy D. Buckler, RLS, 1975. Witness to meander set on the township line, extended from the South at 1364.0 feet North of the quarter corner. Record = 1568.8 feet. Erosion has moved bluff inland 200 feet. Witnesses, 8" J. Pine, S.41°W., 44.7 feet and 8" J. Pine, S. 23°E., 33.9 feet. Corner is 20 feet South of top of bluff. \* Unrecorded restoration. \*\*\*\*\* No other record of restoration.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M11-12: Search made for witness to meander corner and reference trees of the 1975 restoration. All were lost to erosion. Witness to meander corner set on the township line, extended from the South at 1156.4 feet North of the quarter corner. Record = 1568.8 feet. Erosion has moved the bluff inland 283 feet. Set monument and established new reference trees. Corner as monumented is accepted as a careful and faithful witness to the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

MC-11 Set witness corner, Berntsen aluminum monument with 3 1/4" aluminum cap no. AINB30, stamped to locate and identify witness corner position - 412.4 feet South of meander corner position. Established the following reference trees with BT signs, blazed, scribed and painted. Set PK nails for measure with aluminum I.D. washers in the following. \* Jack Pine 10", S.87°E., 5.40 feet, "WC S31 BT"; \* Jack Pine 8", S.20°W., 25.00 feet, "WC S36 BT". \* Survey marker sign on 6 foot steel post, N.50°E., 1.0 feet. Corner is 128 feet South of top of bluff. All bearings are magnetic.


Signed by

Surveyor's Michigan License No.

25849

Date

December 16, 1998

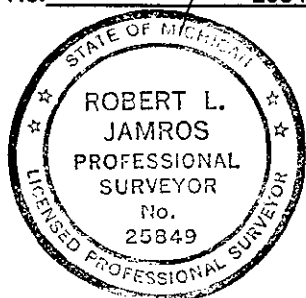

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN, 1986  
REVISED OCT, 1994