

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In:

Arenac
(County)

Located In

Corner Code #



DOC#: 201600538

February 29, 2016 10:45 AM

Fee: \$14.00

Darlene Mikkola
Register of Deeds
Arenac County, MI

Page 1 of 1

CD

ARENAC CO, 201600538-10-16

Register of Deeds Stamp & File Number

| | | | | | |
|--------------------------------------|---|-----|---|-----|----|
| 1. Public Land Survey | T | 20N | R | 05E | C9 |
| | T | | R | | |
| 2. Property Controlling in Section | S | T | R | | |
| | S | T | R | | |
| 3. Miscellaneous Property in Section | S | T | R | | |
| | S | T | R | | |

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Joshua R. Davidson, in a field survey on October 27, 2014 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|---|----|---|----|---|----|---|----|---|----|---|----|---|
| 1 | | | | | | | | | | | | | |
| 2 | | 6 | | 5 | | 4 | | 3 | | 2 | | 1 | |
| 3 | | | | | | | | | | | | | |
| 4 | | 7 | | 8 | | 9 | | 10 | | 11 | | 12 | |
| 5 | | | | | | | | | | | | | |
| 6 | | 18 | | 17 | | 16 | | 15 | | 14 | | 13 | |
| 7 | | | | | | | | | | | | | |
| 8 | | 19 | | 20 | | 21 | | 22 | | 23 | | 24 | |
| 9 | | | | | | | | | | | | | |
| 10 | | 30 | | 29 | | 28 | | 27 | | 26 | | 25 | |
| 11 | | | | | | | | | | | | | |
| 12 | | 31 | | 32 | | 33 | | 34 | | 35 | | 36 | |
| 13 | | | | | | | | | | | | | |

A. Description of original monument and accessories and/or subsequent restoration:

C9 – corner common to sections 19, 20, 29 & 30, T20N, R5E

- 1846 – GLO – B. F. Hall – set post corner sections 19, 20, 29, 30 –
1) Hemlock 12" N61°E 18; 2) Hemlock 12" S27°W 09.
- 1922 – CSR – Book 12, Page 78 – cor. 19-20-29-30. – 3) WP ST 28 SW 65.
- 1983 – Certificate of Survey L. 1, P.491 – R. Miller, PS # 16050 – R.R. Spike. – 4) S45°E 58.15' 9" Maple; 5) North 46.35' F.C.; 6) S30°W 48.60' 6" Oak; 7) N70°W 82.53' P.P.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


C9 – corner common to sections 19, 20, 29 & 30, T20N, R5E

Found ½" rebar 6' South of road centerline. Location of ½" rebar did not fit Miller's 1983 accessories or measurements. Set a 3" brass cap on 5/8" X 34" rebar from 1983 accessories – #4(stump), #6, and #7(stump). 3" brass cap on 5/8" X 34" rebar is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C9 – stamped 3" DNR brass cap on 5/8" x 34" long rebar.

N25°E 63.72' to found mag nail in NW. side 22" W. Pine
S45°E 58.20' to set nail & tag at found nail in SW. side R. Maple
S33°W 45.10' to set nail & tag NW. side 7" W. Pine
N65°W 82.36' to found nail in power pole (#6)
S14°23'W 6.31' to found ½" rebar

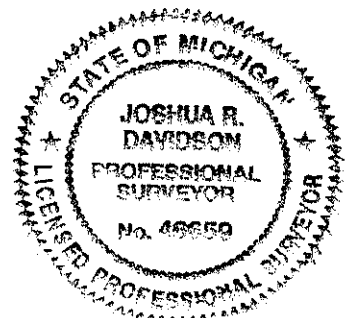

Signed by:

Josh R. Davidson

Date:

February 24, 2016

Surveyor's Michigan License No.:

46659