

MAR : 0 1999

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

Chippewa County Remonumentation Corner 7.00 LAND CURNER

For	corners	in
-----	---------	----

Chippewa County	Located in:			Corner Code #
Public Land Survey		T44N T T T	R2W R R R	F-11
<ol> <li>Property Controlling in Section</li> <li>Miscellaneous Property in Sec.</li> </ol>	\$ \$ \$ \$	T T T T	R R R	

5 MAR 1999 2:05:43 PM Receipt #14029 RECEIVED FOR RECORD

CHIPPENA COUNTY - STATE OF MICHIGAN SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 11 PAGE 20

Register of Deeds Stamp & File Number


4. Lot No.

, Recorded Plat

5. Private Claims

I, Keith R. Waters, in a field survey on December 21, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

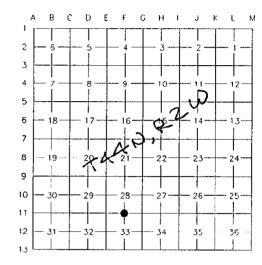

A. Description of original monument and accessories and/or subsequent restoration:

## F-11 1/2 Corner Common to Sections 28 & 33, T44N, R2W

1845 - Original corner (12" Aspen) established by James Mullett.

1905 - Chippewa County Surveyor Frederick H. Brown, RLS 944, notes for Section 28 show corner midway on line section corners 2650 feet east and 2650 feet west.

1915 - Brown's notes for Section 33 show essentially the same distances as Section 28 notes. Brown specifically notes that this ¼ corner is gone, in second growth.

1995 - Certificate of Survey, liber 661, page 287, Chippewa County records. Corner is shown as a found boat spike, raised with ½" rod.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being reestablished as part of the Chippewa County Remonumentation Program.

Found no evidence of the original corner. Found the ½" rod as shown on above mentioned Certificate of Survey as recorded in liber 661, page 287. According to 1961 plans for Highway I-75 (Project #17033A, C5 & C6RN, sheet #6) the boat spike which the ½" rod was placed over is an alignment P.O.T. at Station 202+30.00, and was not intended to represent the ½ corner F-11. I reestablished the ½ corner F-11 by single proportionate measurement midway on line between section corners at E-11 2651.0 feet west and at G-11 2651.0 feet east.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

Placed a ¾" x 24" rebar with a stamped aluminum Chippewa County Remonumentation cap at the corner location, which falls in the median of Highway I-75, 50.3 feet from the centerline of the northbound lanes and 43.6 feet from the centerline of the southbound lanes. Witnesses:

Nail and witness tag in Power Pole (RU2/24B/35), S81°E 165.78' Nail and witness tag in Power Pole (RU2/24B/36), S81°W 152.35' Nail and witness tag in Guard Rail Post (north end), N83°E 179.81' Nail and witness tag in 4" Balsam Fir, N85°W 134.54' 1/2" Iron Rod (over boat spike at P.O.T. Station 202+30.00), N21°E 9.60'

KEITH H.
WATERS
PROFESSIONAL
SURVEYOR
No.
3 3 1 4 2

Signed by Keith R. Water

Date 12-30-98

Surveyor's Michigan License No. 33142

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED JAN., 1983
REVISED OCT., 1995

BOOK IL PAGE ZV