

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Chippewa Co.

3 Corners.

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. <u>49</u> N. <u>2</u> R. <u>7</u> E. W.		I-12
2. PROPERTY CONTROLLING IN SECTION <u>35</u> T. <u>49</u> N. <u>2</u> R. <u>7</u> E. W.		9-Sec.35, 13-Sec.35
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ N. _____ S. R. _____ E. W.		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-30, 1981, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- I-12 1/4 Cor. bet. Sec's. 34-35, set by Wells Burt D.S. in 1849. Bearings were: Cedar 10", S57°E, 30 lks. & Spruce 8", N2°W, 9 lks.
- 9-Sec.35 East 1/16 corner of Section 35.
- 13-Sec.35 Southeast 1/16 corner of Section 35.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- I-12 Re-established corner in swamp, one chain North of edge, using other corners to South, North, and some old blazes.
- 9-Sec.35 Placed corner midway bet. Center Corner and the East 1/4 corner.
- 13-Sec.35 Placed corner at intersection of computed lines quartering the South - East quarter section.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- I-12 Placed 1" pipe with 4" alum. cap at corner. New Bearings: 10" Cedar, N84°E, 7.2' & 6" Cedar, S9°W, 7.4' & 4" Cedar, N51°W, 4.0'.
- 9-Sec.35 Buried 36" T-Iron in East edge of gravel Road. Bearings: 16" R. Pine, N82°W, 56.1' & 10" J. Pine, N9°E, 50.1' & 10" J. Pine, N86°E, 63.1'.
- 13-Sec.35 Placed 1" pipe with 4" alum. cap at corner. Bearings: 7" J. Pine, N48°W, 6.0' & 6" J. Pine, S86°W, 10.4' & 7" J. Pine, S49°W, 10.1'.

SIGNED BY Billy D. Buckler DATE 7-31-81

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

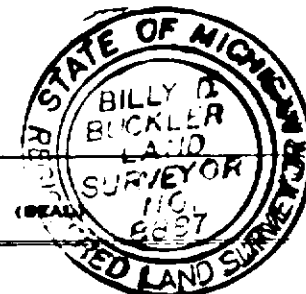

SURVEYOR'S MICHIGAN REGISTRATION NO. _____