

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1998 JUN 12 AM 8:59

For corners in

Dickinson
(County)
Norway Twp.

Located in:

Corner Code #

1. Public Land Survey

T 39NR 29W

K-4

T R

M-4 ✓

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

REGISTER OF DEEDS
DICKINSON COUNTY
IRON MOUNTAIN, MI 49801
SURVEY &
REMONUMENTATION

APR 02 1999

SECTION
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Robert F. Perkins, in a field survey on Mar. 19, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

ACCEPTED BY THE DICKINSON COUNTY
SURVEY PEER GROUP AS THE OFFICIAL
CORNER UNDER MICHIGAN PUBLIC ACT
345 OF 1990 AT A MEETING HELD ON
6-4-98
RFP

COUNTY REPRESENTATIVE

A. Description of original monument and accessories and/or subsequent restoration:

K-4 $\frac{1}{4}$ Corner, 11/12
James H. Mullett, D.S. 1849
40.00 Set $\frac{1}{4}$ Post
Original Bearing Trees
Hemlock 12" S30°E 22 L.
Hemlock 6" N65°W 17 L.
Corner Researched in 1994

M-4 East $\frac{1}{4}$ Corner, Section 12
James H. Mullett, D.S. 1849
40.00 Set $\frac{1}{4}$ Post
Original Bearing Trees
Maple 10" S30°W 20 L.
Fir 6" N80°W 15 L.
V5°50'E
Corner Researched in 1993

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-4 No evidence of Original Corner
or Accessories Found.
Established Corner by Single
Proportionate Method on Line with
Section Corners $\frac{1}{2}$ Mile North and
 $\frac{1}{2}$ Mile South. Found remains of
Barbed Wire Fence running South.

M-4 No evidence of Original Corner
or Accessories Found.
Found 1" Drill Steel in Concrete
projecting 12". Also Oak B.T. by B.Buckler RLS
(old Report #615, 2-21-1961).
Distance checks South to 1/16 Corner and
Section Corner. Monument resembles type set
by Mining Co., circa 1900.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-4 Set $2\frac{1}{2}$ " Stamped D.C. Remon. Corner.
New Witnesses:
Hemlock 12" N85°W (M.B.) 35.76' Nail/Tag
Maple 6" N77°E (M.B.) 10.55' Nail/Tag
Maple 4" S27°E (M.B.) 1.40' Nail/Tag
Dbl. Maple 6" S48°W (M.B.) 17.70' Nail/Tag
Placed Carsonite Marker North 1.0'

M-4 Accepted above monument as best remaining
Evidence of Corner Location.
Stamped Existing Iron 12/7
New Witnesses:
Oak 22" N30°W (M.B.) 59.90' (Old B.T.)
W.Pine 10" S61°E (M.B.) 43.93' Nail/Tag
Hemlock 10" N45°W (M.B.) 10.83' Nail/Tag
Oak 5" S15°W (M.B.) 26.29' Nail/Tag
Carsonite Marker North 1.4'


Signed by

Robert F. Perkins

Surveyor's Michigan License No. 12027

Date

June 12, 1998

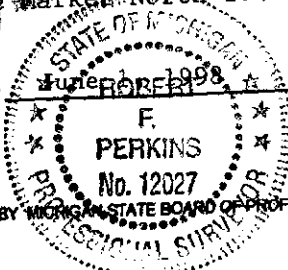

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995