

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

(County)

Located In:

Corner Code #

1. Public Land Survey

T 39N R 29W

J4

T R

T R

T R

**2. Property Controlling
in Section**

S 11

T 39N R 29W

9

S T R

**3. Miscellaneous
Property in Sec.**

S

T R

S

T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

Dec 20 1999

I, Stephan J. Szyszkoski, in a field survey on , 19 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(J4) Center of Section 11. According to records received from R.F.Perkins, RLS 12027, this corner was apparently established in 1908 by W.J. Leekey: "Established the center post of section 11 by the intersection of straight lines joining the 1/4 stakes, finding the old center post of the subdivision made years ago". A drawing, apparently Leekey's, shows dist. east to 1/4 corner 2615.0'. Records of R.F.Perkins show 2" iron pipe at intersection of fence lines N,S,E, and W, ("occupied C1/4") with the following witnesses: R.Pine 4" N35E 6.90', Maple 14" N70W 16.55'

(9-Sec. 11) East 1/16 corner, Section 11. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(J4) Found a 2" iron pipe in good condition, in fence intersection, and at record bearing and distance from R.F.Perkins witnesses noted above. Distance east to Dickinson Co. Remonumentation Program monument is found to be 2625.10'. The Leekey drawing shows distances west to 1/4 corner 2880.4' (and also whole mile I4-K4=5435.4', which does not equal the sum of Leekey's two half-mile dimensions), and south to 1/4 corner 2598.0 (with mile J3-J5=5222.5'), but I did not measure to any but the East 1/4 corner of Sec. 11. I use the monument as the Center of Section 11 in order to establish the E1/16 corner of Section 11, 1312.55' East. Left the monument in place and made two new witnesses as described below.

(9-Sec. 11) Established the corner midway and on a straight line between Center of Section 1312.55' West and Quarter corner 1312.55' East. At the position for the corner I placed a 1" IDx32" iron pipe capped with a yellow plastic cap stamped "MICH DNR PS 33986".

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J4) Found 2" iron pipe. Blazed and scribed the following:

7" W.Pine S15W 16.2' "C1/4 BT"

16" Oak S64W 25.6' "C1/4 BT"

Dist. to notch in lower blaze.

The Perkins' wits:

14" Maple N70W 16.6' fd nail in side

4" R.Pine N35E 6.9' fd nail in side

Bearings are magnetic.

(9) Set 1" pipe with plastic cap.

Blazed and scribed the following:


4" W.Pine S14E 31.1' "1/16S BT"

3" W.Pine N76E 23.4' do

12" Maple N44W 26.5' do

7" W.Pine S80W 37.6' do

Bearings are magnetic. Distances are to notch in lower blaze.

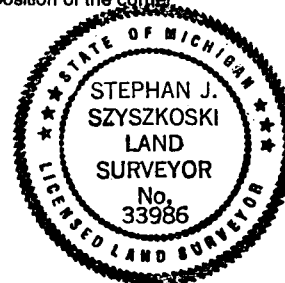

Signed by

Stephan J. Szyszkoski

Date

4/24/00

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division