

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1998 DEC 14 PM 12: 25

For corners in

<u>Dickinson</u>	Located In:	Corner Code #
(County)		
Norway Twp.		
1. Public Land Survey	T <u>40NR 29W</u>	<u>K-2</u>
	T <u>    R    </u>	<u>K-8</u>
	T <u>    R    </u>	
	T <u>    R    </u>	
2. Property Controlling in Section	S <u>    T    </u>	
	S <u>    T    </u>	
3. Miscellaneous Property in Sec.	S <u>    T    </u>	
	S <u>    T    </u>	

REGISTER OF DEEDS  
DICKINSON COUNTY  
RON MULLETT, D.S. 1849

Register of Deeds Stamp & File Number

SECTION

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Robert F. Perkins, in a field survey on Sept. 24, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2					●		
3												
4	7	8	9	10	11	12						
5												
6	10	17	16	15	14	13						
7												
8	19	20	21	22	23	24				●		
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

K-2 ½ Corner Common to Sections 1 & 2  
Post by J.H. Mullett, D.S. 1849  
Original Bearing Trees  
Fir 12" S73°W 10 Lk.  
Hemlock 12" N47°E 30 Lk.

K-8 ½ Corner Common to Sections 23 & 24  
Post by J.H. Mullett, D.S. 1849  
Original Bearing Trees  
Sugar 10" N74°W 15 Lk.  
Cedar 12" N70°E 10 Lk.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-2 No Evidence of Original Corner or Accessories Found.  
Found 1½" Iron Pipe Set in 1935 by W.C. Johnson, C.E.  
Dickinson County Road Commission  
File A-8  
Corner Researched 11-19-97


K-8 No Evidence of Original Corner or Accessories Found.  
Found 1½" Iron Pipe Set by W.C. Johnson, C.E. in 1935.  
Dickinson County Road Commission  
File A-8, #46, Sh.#3  
Corner Researched 11-19-97

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-2 Accepted Iron Pipe described in "B" above. Placed 2½" Stamped D.C. Remon. Corner inside of Existing Iron Pipe.  
New Witnesses  
Maple 4" S22°E(M.B.) 25.08' Nail/Tag  
Maple 13" N75°E(M.B.) 24.24' Nail/Tag  
Maple 4" N09°E(M.B.) 15.42' Nail/Tag  
Maple 10" S60°W(M.B.) 5.10' Nail/Tag  
Placed Carsonite Marker 1.0' North.

K-8 Accepted Iron Pipe described in "B" above. Replaced same with 2½" Stamped D.C. Remon. Corner.  
New Witnesses:  
Maple 6" N13°W(M.B.) 20.56' Nail/Tag  
Maple 3" S25°W(M.B.) 13.68' Nail/Tag  
Maple 3" S32°E(M.B.) 17.35' Nail/Tag  
Ironwood 3" N86°E(M.B.) 30.88' Nail/Tag  
Placed Carsonite Marker 1.0' East.

Signed by Robert F. Perkins  
Surveyor's Michigan License No. 12027

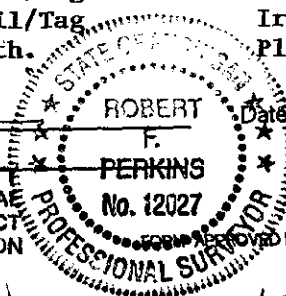

Date Oct. 28, 1998

ACCEPTED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 12-7-98  
Robert F. Perkins  
COUNTY REPRESENTATIVE

Liber 2 Page 414