

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

DICKINSON COUNTY

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>40</u> N. <u>X</u> , R. <u>30</u> W.	<u>G-4 & G-5</u>
2. PROPERTY CONTROLLING IN SECTION <u>10</u>	T. <u>40</u> N. <u>X</u> , R. <u>30</u> W.	<u>10</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____, R. _____ E. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 13, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner G4 (1/4 corner between Sections 9 & 10, T40N, R30W):

Wood post (Not found. No subsequent monuments found.)
 Birch 11 N15W 3 (Not found. No subsequent accessories found.)
 Birch 4 S68W 3 (Not found. No subsequent accessories found.)

Corner G5 (Section Corner 9, 10, 15, & 16, T40N, R30W):

Wood post (Not found. No subsequent monuments found.)
 Aspen 6 N35E 26 (Not found. No subsequent accessories found.)
 Aspen 5 N70W 27 (Not found. No subsequent accessories found.)

Corner 10 (South 1/16 corner between Sections 9 & 10, T40N, R30W): Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner G4: Restored on line between Sec. Corners 40.651 ch. to N and to S.

Corner G5: Restored by reference to Sec. Cor. 80.10 ch. W and alinement with old farm field edge to E, and with Sec. Cor. 81.30 ch. N alined with N & S road to S. These features are all presumed to be the sec. corners and sec. lines by common report and usage. There are discrepancies between found distances and record distances in both N & S and E & W lines in this area, with the major part of the E & W discrepancy appearing, from the actions of the pioneer landowners, to be in the sec. line bet. Sec. 10 & 15, which is short by 1.85 chains

Corner 10: Established on line between Sec. Cor. 20.325 ch. S and 1/4 cor. 20.325 ch. N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monuments for all 3 corners: 1" I.D. x 36" iron pipe with 3 3/4" aluminum caps.

Witnesses for Corner G4: Red Maple 5 S39°E (mag.) 8.6 ft. "1/4S, NBT"
 Declination 1°40' West. Red Maple 5 N63°E (mag.) 14.9 ft. "1/4S, NBT"

Witnesses for Corner G5: J. Pine 12 S37 1/2°W (mag.) 25.8 ft. "S16, NBT"
 Declination 2°30' West. J. Pine 13 N47°W (mag.) 6.6 ft. "S 9, NBT"

Witnesses for Corner 10: R. Pine 15 N12°W (mag.) 32.5 ft. "1/16S, BT"
 Declination 3°20' West. J. Pine 8 N31°E (mag.) 22.8 ft. "1/16S, BT"

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____


APPROVED AND SIGNED BY Arthur O. Enger DATE March 15, 1979

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger

Michigan Department of Natural Resources

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581

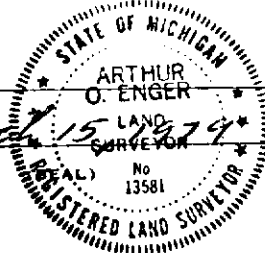

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 26, 1971
 REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET