

SURVEY & REMONUMENTATION

FILED

JAN 11 2001

00 AUG 14 AM 11:00

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 ROXAND TOWNSHIP

For corners in

LINDA M. TWITCHELL
REGISTER OF DEEDS
EATON COUNTY, MICH.

Eaton _____ Located In: _____ Corner Code # _____
(County)

1. Public Land Survey T 4N R 5W D-12
T _____ R _____
T _____ R _____
T _____ R _____

2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

LIBER 4 PAGE 136

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, RON HELSEL, in a field survey on JUNE 21, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
THIS CORNER WAS NOT SET IN THE ORIGINAL GOVERNMENT SURVEY

1) VOL. 1, PAGE 39, MARCH 1867, CO. SURVEYOR W.D. SOUTHWORTH DIVIDED THE SOUTHWEST 1/4 OF SECTION 32 INTO 3 PARCELS BUT DID NOT IDENTIFY ANY CORNERS OR GIVE ANY WITNESSES ON THE SURVEY.

DID NOT FIND ANY PUBLIC RECORDS OR SURVEYS TIED TO THIS CORNER.


1	A	B	C	D	E	F	G	H	I	J	K	L
2		6		5		4		3		2		1
3												
4		7		8		9		10		11		12
5												
6		18		17		16		15		14		13
7												
8		19		20		21		22		23		24
9												
10		30		29		28		27		26		25
11												
12		31		32		33		34		35		36
13												

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

EXCAVATED HOLE IN THE CENTERLINE OF LOUCKS ROAD OPPOSITE FENCE LINES TO THE WEST AND THE EAST, DOWN WELL BELOW GRAVEL AND CLAY SUBBASE. DID NOT FIND ANY EVIDENCE OF A PREVIOUS CORNER. SET STANDARD 3/4" BY 24" FORM PIN WITH EATON COUNTY DISK AT THE INTERSECTION OF THE 1/4 LINES. CORNER LOCATED ON FENCE LINES TO THE EAST AND TO THE WEST AND 5 FEET EAST OF THE CENTERLINE OF LOUCKS ROAD.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

3/4" FORM PIN AND EATON COUNTY DISK STAMPED P.A. 345, P.S. 18994, 5 FEET EAST CENTERLINE OF LOUCKS ROAD.
SET NAIL & TAG NO. 18994 WEST/SIDE 12" MAPLE, NORTH AZ. 171°, 19.94 FEET
SET NAIL & TAG NO. 18994 SOUTH/SIDE 12" MAPLE, NORTH AZ. 117°, 51.28 FEET
SET NAIL & TAG NO. 18994 NE/SIDE 10" ELM, NORTH AZ. 220°, 47.69 FEET
SET NAIL & TAG NO. 18994 NORTH/SIDE 4" HICKORY, NORTH AZ. 265°, 34.47 FEET
MEASURED WEST, 2641.63 FEET TO C-12
MEASURED NORTH, 2642.12 FEET TO D-11
MEASURED EAST, 2652.41 FEET TO E-12
MEASURED SOUTH, 2642.72 FEET TO D-13

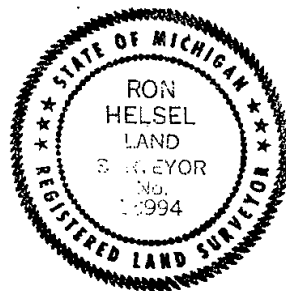

Signed by Ron Helsel
Surveyor's Michigan License No. 18994

Date Aug. 2, 2000