## SURVEY & REMONUMENTATION

AUG 0 8 1997

For corners in

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Register's Mincel
Register's Milice sand
Received for record the
11th day of June
A. D. 1997 at 10:45 o'clock
A m., and recorded to
Liber 6 of CORNERS
m mas 154
( Alleon M. Richar, Wexur
Register of Danie

	Gogebic (County)	Located In:	Corner Code ##
1.	Public Land Survey	T 45N R 46W	IJ 2-3
		T R T R	005
2	Bronorty Controlling	T R	
2.	Property Controlling in Section	S T R S T R	
3.	Miscellaneous	S T R	
	Property in Sec.	S T R	


Register of Deeds Stamp & File Number

ł.	Lot No, Recorded Plat
ō.	Private Claims

Mile Corner  $\#4\frac{1}{2}$ , Mich.---Wisc. State Line

I, Richard L. Drahn in a field survey on May 21 , 19 97 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

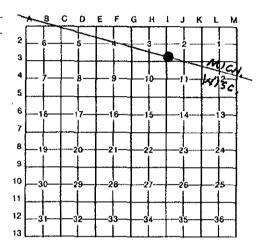

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by William Burt in 1847. Original B.T.s --- Y. Birch 10" S.22 E. 5 links (3.30') --- Cedar 10" N.35 W. 13 links (8.58') ---

Corner restored in 1928 by Earl G. Harrington from the two original B.T.s. The Y. Birch was a decayed stump and the Cedar was a live, 18" Cedar with scribing visible. He set a standard brass capped concrete monument and one new B.T.; ----Cedar 6" S.10-30 W. 21.8 ft.---

Research form on file with Gogebic County records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Recovered the 1928 standard brass capped concrete monument as described in Harringtons notes. The 1928 B.T. is now a 16" decayed Cedar windfall with GLO blaze under water.

No evidence remains of the 1847 Y. Birch B.T. The Cedar at N.35 W. is now a large windthrown decayed tree with GLO blaze.

Richard Drain 6/10/97
COUNTR REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: From the above described concrete monument I established the following:

13"	Cedar	N.06 E.	29.91 ft.
10"	Cedar	N.68 E.	31.54 ft.
16"	Cedar	s.36 W.	35.66 ft.
6 !	Steel sign rail	N.34 E.	1.64 ft.



FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

Signed by Richard & Dealin

June 5, 1997

Date \_\_