

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 26 N. R. 12 W.	H-4; I-3; I-4
2. PROPERTY CONTROLLING IN SECTION 10	T. 26 N. R. 12 W.	7
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S. R. E. W.	
4. LOT NO.	RECORDED PLAT	
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on January 15, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on 19, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restoration:~~

C. (continued)

7
Set 1 1/4"x6' pipe & cedar post
w/loc. tag
10" Maple S89°E 20.5
16" W. Pine S52°E 49.5
7" Tamarack N78°W 20.9
N-S Rand. Due E 2.3
Irreg. Fence (down) Due W 4±

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- H-4 Restored center of Sec. 10 at intersection of quarter lines, which fits George Steele split-up of Sec. 10 in 1887.
- I-3 Restored corner from possible U.S.B.T. (cedar stump) which fits C.P. Tuller survey of 1893. Corner fence post with irregular fence remains north & east is N12°E, 42'.
- I-4 Recovered concrete monument by R.L.S. Fraser.
- 7 Established corner per standard B.L.M. instructions. This fits survey by C.P. Tuller very close.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-4	I-3	I-4
Set 1 1/4"x6' pipe and cedar post w/loc. tag	DNR Mon. & cedar guard post	Found 4" Conc. Mon. set cedar post w/loc. tag
7" Maple Due E 51.3	11" Cedar N60°W 14.8	12" Maple N05°E 35.8
12" Maple S51°E 40.0	5" Cedar N52°E 58.2	7" Oak N14°W 56.0
Twin 10" Maples Due W 78.0	7" Cedar S49°E 41.0	6" Oak S02°E 39.4
Ctr. E-W Trail Rd. Due S 68±	19" W. Pine S01°E 52.1	N-S Fence Due W 5.5
4" Conc. Mon. S37°E 41.97	N-S Rand. Due E 4.5	
	Rand. W Due N 63.8	

SIGNED BY

Carl F. Roser

9-3-75

DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY


CHIEF OF SURVEY PARTY

DATE

APPROVED AND SIGNED BY

MICHIGAN REGISTERED LAND SURVEYOR

DATE

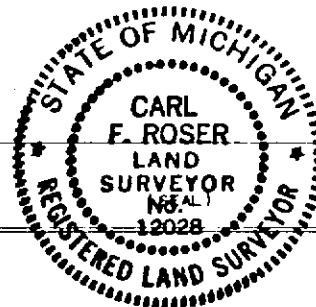

GREEN LAKE TOWNSHIP
GRAND TRAVERSE COUNTY