

2000 REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Re-New Leher 2, Page 92

For Corners in

Huron
(County)

Located in:

Corner Code #

STATE OF MICHIGAN
HURON COUNTY
RECORDED

29 NOV 2000 11:21 AM

FRANCES L. HOLDWICK
REGISTER OF DEEDS

1. Public Land survey: Sebewaing T 15 N R 9 E A-11
T R A-12 ✓
T R
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R
4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

SURVEY &
MONUMENTATION

JAN 19 2001

Register of Deeds Stamp & File Number

I, James T. Meek, in a field survey on October 1, 2000,
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original survey, West Bdy. T15NR9E, 1835, Harvey
Parke D.S.

A-11 Corner of Sections 30, 31
Post
Lynn 14", N25°W, 11 links
Beech 10", S6°E, 23 links

County Surveyor's Record: none
Recorded Surveys: none
LCRC: none

A-12 West ¼ Corner of Section 31
Not monumented

County Surveyor's Record: none
Recorded Surveys: none
LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-11 Corner of Sections 30, 31

Found no evidence of the original corner
position
Set ¼" iron at proportionate distance
between M-9 & M10, T15NR8E on West
shoulder of Michigan Highway M-25
Centerline of Bach Road bears East

A-12 West ¼ Corner of Section 31

Found no evidence of the original corner
position
Chisled '+' in concrete at proportionate
distance between M-10 & M-11, T15NR8E

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

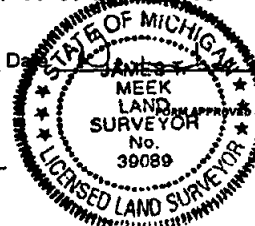
A-11 Corner of Sections 30, 31

½" iron w/cap #39089
From which:
¼" iron bears N0°W, 87.33'
Tag in power pole bears S65°W, 54.3'
+ Brass Cap bears N85°W, 14.4'
+ Top of conc ROW bears N37°W, 131.8'
M-9, Corner of Sections 24 & 25, T15NR8E
bears N0°00'00"E, 78.77'
M-10, East ¼ corner of Section 25,
T15NR8E bears S0°00'00"W, 2546.81'

A-12 West ¼ Corner of Section 31

¼" iron w/cap #39089 in mon box
From which:
¼" iron bears N20°E, 90.4'
Tag in wood post bears S70°E, 64.4'
Chisled 'x' bears N35°W, 110.2'
Chisled 'x' bears N25°W, 152.8'
M-10, East ¼ corner of Section 25, T15NR8E
bears N0°00'00"E, 94.52'
M-11, Corner of Sections 25 & 36, T15NR8E bears
N0°00'00"E, 2531.06'

Signed by

Surveyor's Michigan License No. 39089APPROVED AT PEER BOARD MEETING 11-02-00 R&B

2, 2000

APPROVED BY MICHIGAN BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN, 1983
REVISED OCT., 1995