

2000 REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in

Huron
(County)

Located in:

Corner Code #

STATE OF MICHIGAN
HURON COUNTY
RECORDED

29 NOV 2000 11:22 AM

FRANCES L. HOLOWICK
REGISTER OF DEEDS

1. Public Land survey: Brookfield T 15_N_ R 10_E

T R

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

A-11 ✓

A-12

SURVEY &

MONUMENTATION

JAN 19 2001

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

SECTION

5. Private Claims

I, James T. Meek, in a field survey on October 1, 2000,
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original survey, West Bdy. T15NR10E, 1835,
Harvey Parke D.S.

A-11 Corner of Sections 30, 31
Post
Elm 12", N20°W, 27½ links
Cedar 6", S18°W, 9 links

County Surveyor's Record: pin in a post
Recorded Surveys: none
LCRC: none

A-12 West ¼ Corner of Section 31
Post
B. Ash 16", S37°W, 13½ links
Maple 7", N33°W, 35 links

County Surveyor's Record: none
Recorded Surveys: none
LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-11 Corner of Sections 30, 31

Found 1" iron in mon box
At intersection Bay Port & Bach Roads

Accepted as the best available evidence
of the original corner position.

A-12 West ¼ Corner of Section 31

Found 2" iron in mon box
3' East of centerline of Bay Port Road
Occupation bears West

Accepted as the best available evidence
of the original corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-11 Corner of Sections 30, 31

1" iron in mon box

From which:

Road sign post bears N75°E, 34.6'

Wood sign post bears S15°E, 51.8'

Tag in power pole bears S30°W, 76.6'

Tag in power pole bears N10°W, 128.6'

A-12, ¼ Corner of Section 31 bears

S0°00'02"E, 2631.78'

A-10, ¼ Corner of Section 30 bears

N0°19'59"W, 2631.60'

A-12 West ¼ Corner of Section 31

2" iron in mon box

From which:

¼" iron bears N45°E, 20.0'

¼" iron bears S45°E, 20.0'

¼" iron bears S45°W, 30.0'

¼" iron bears N45°W, 30.0'

A-13, Corner of T14-15N, R9-10E bears

S0°00'00"E, 2631.74'

A-11, Corner of Sections 30, 31 bears


N0°00'02"W, 2631.78'

Signed by

Date

Surveyor's Michigan License No. 39089

APPROVED AT PEER BOARD MEETING 11-02-00 RLB

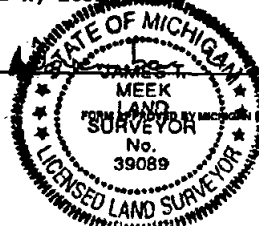

FORM PREPARED BY MICHIGAN BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1971
REVISED JAN., 1974
REVISED OCT., 1975