ACCEPTED BY THE HILLSDALE COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 365 OF 1890 A MEETING HELD ON THE NEW THE
AL RINGENGERG, CO

LIBER 5 PAGE 47

HILLSDALE COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED HILLSDALE CO. MICH.

00 NOV 13 AM 11:09

gray Canjanar REG. OF DEEDS

For a	corners	in
-------	---------	----

4. Lot No. 5. Private Claims

TILLSUALE	_ Located in:	Corner Code #
(County) PITTSFORD TWP.	•	
1. Public Land Survey	T <u>7S</u> R <u>1W</u>	G-7
	T R T R	
2. Property Controlling	T_R S T R	
in Section	STR	
3. Miscellaneous Property in Sec.	ST_R S_T_R	

_ , Recorded Plat

SUBVEY & EMONUMENTATION

JAN 122001


SECTION

Register of Deeds Stamp & File Number

		•	
I, Frederick J. Cutch	<u>ner</u> , in a field	survey on Oct. 22, 2000	_do hereby state the
under requirements of	P.A. 74, Michigan P.A.	of 1970, the comer points	mentioned in lines

current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

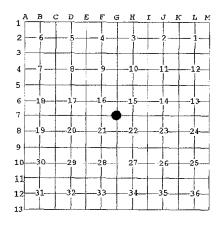

Description of original monument and accessories and/or subsequent restoration:

GLO, Robert Clark, Jr., 1824: Set Post; Elm 8" S. 9° E. 24 lks. Geo. Mark, Mar. 17, 1871, Survey #597: Stone & Brick. M.S.H.D., Dec. 1967: Found iron bar 0.5' below pvmt. raised with R.R. spike; 1.3' North of centerline M-34; N. 30° E. 65.17' bldg. cor.; S. 45° E. 83.92' bldg. cor.; S. 30° W. 60.00' fnc. Cor.; N. 35° W. 46.55' street sign.

LCRC L.1, P. 43, Sept. 7, 1971, A.J. Hatt: R.R. spike 2.0' North of centerline M-34; N.E. cor. Fed. Aid Tri. Conc. Marker S. 30°W. 57.2'; N.W. cor. old school house bidg. S. 45° E. 84.0'

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1-1/4" iron pipe in monument box and both of Hatt's references. Also found one M.S.H.D. reference.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 1/2"x 6" iron with remonumentation cap in 1-1/4" iron pipe in monument box and is accepted as the best available evidence of the position of the original corner.

1.5' North of centerline M-34 and in line with centerline Waldron Road.

N.W. cor. Town Hall S. 40° E. 84.00'

Nail & spotter pwr. pole N. 25° W. 65.73'

Top cen. Fed. Aid Conc. Marker S. 37° W. 57.67'

Cen. 12" Maple N. 37° E. 99.73

A STATE OF THE STA 4 FIREDERICK CUTCHER PROFESSIONAL Ma 20年20月

Signed by Frederic J. Cutcher

Surveyor's Michigan License No.

24592

11/9/2000

DEESSION NO. PARTER SILVANDE