

SURVEY & REMONUMENTATION

FEB 21 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Iron</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>31W</u>	<u>C-13</u> ✓
	T <u>42N</u> R <u>31W</u>	<u>C-1</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

COMMENCING YEAR 2000
RECEIVED FOR RECORD
IRON COUNTY, MICHIGAN

00 DEC 22 PM 3: 27

L.C. Records: L. 8, P. 322

Gary L. Pisoni
REGISTERED LAND SURVEYOR

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

Section Corner to Sections 31 and 32, T43N, R31W
Section Corner to Sections 5 and 6, T42N, R31W

I, Gary L. Pisoni, in a field survey on November 28, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on July 30, 1846 by John Burt, U.S. Deputy Surveyor.

Original Corner: Hemlock Post

Original Bearing Trees:

Sugar	6"	N 22° E	39 links (25.74 feet)
Hemlock	14"	N 04° W	65 links (42.90 feet)

On July 31, 1849, John Burt, U.S. Deputy Surveyor, established the following new bearing trees:

White Pine	18"	S 33° E	58 links (38.28 feet)
Yellow Pine	8"	S 43° W	45 links (29.70 feet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.

Found a WI/MI Power Company concrete monument with a brass cap marking corner position, 6" above ground surface and stamped as follows: T43N, R31W, S-31, S-32, S-6, S-5, T42N

I accept the concrete monument as the best available evidence for restoring the corner position.

Corner record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Blazed and scribed the following new bearing trees: (all measurements taken to a nail in side of tree)


Red Maple	6"	N 18° W	33.03 feet
Spruce	7"	N 71° E	19.08 feet
Oak	8"	S 48° E	11.70 feet
Red Maple	6"	S 30° W	11.02 feet
Steel sign post		N 63° W	0.76 feet

00-090

Signed by Gary L. Pisoni Date 12-19-2000

Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN 25, 1971

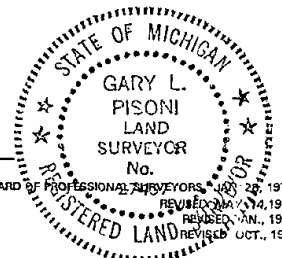

LIBER

8 PAGE 322