

# SURVEY & REMONUMENTATION

FEB 21 2001

## SECTION

### LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

or corners in

Iron  
(County)

Located In:

Corner Code #

Public Land Survey

T 44N R 33W

M-11 ✓

T 44N R 32W

A-11

T R

T R

Property Controlling

S T R

in Section

S T R

Miscellaneous

S T R

Property in Sec.

S T R

COMMENCING YEAR 2000  
RECEIVED FOR RECORD  
IRON COUNTY, MICHIGAN

00 DEC 22 PM 3:26

L.C. Records 1.8, P. 318

*Robert J. Ellis*  
REGISTERED SURVEYOR

Register of Deeds Stamp & File Number

Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

Private Claims \_\_\_\_\_

Gary L. Pisoni, in a field survey on October 31, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

1. Description of original monument and accessories and/or subsequent restoration:

Original corner established on August 6, 1846 by Austin Burt, U.S. Deputy Surveyor.

Original Corner: Fir Post

Original Bearing Trees:

Hemlock 14" S 40° W 33 links (21.78 feet)

Sugar 8" N 45° E 27 links (17.82 feet)

On July 16, 1849, Z.B. Searls, U.S. Deputy Surveyor established the following new bearing tree:

Spruce 12" S 10° E 24 links (15.84 feet)

On June 11, 1971, Arthur O. Enger, RLS DNR restored the section corner position from a found 2" well point and set a 1" diameter by 36" iron pipe with a 4" diameter aluminum cap stamped as follows: T44N, R33W, R32W, S-25, S-30, S-36, S-31, RLS 13581. Recorded in Liber 1, Page 199-200 of LC records.

1971 Bearing Trees:

Sugar Maple S 83° E 10.5 feet

Red Maple N 15° W 17.4 feet

3. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.

Found monument as described above and the following bearing trees:

Sugar Maple 16" (dbl) N 60° W 21.21 feet

Red Maple 16" N 17° W 17.87 feet

Monument is 12" above ground surface.

Corner record research on file with County Representative.

2. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Blazed and scribed the following new bearing trees: (All measurements taken to a nail in side of tree)

Balsam 6" N 63° E 10.94 feet

Balsam 7" S 18° W 17.82 feet


Steel sign post North 0.65 feet

00-086

Signed by Gary L. Pisoni Date 12-19-2000

Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN 28, 1971

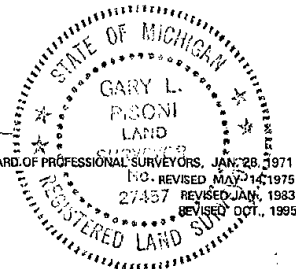

LIBER

8 PAGE 318