

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

**SURVEY &  
REMONUMENTATION**

FEB 26 2001

SECTION

KALKASKA

(County)

Located In:

Corner Code #

2000 REMONUMENTATION

1. Public Land Survey

T 25N R 5W

C-9

T R

T R

T R

T R

2. Property Controlling  
in Section

S T R

S T R

3. Miscellaneous  
Property in Sec.

S T R

S T R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, EUGENE FARRIER, in a field survey on December 12, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-9: Sec. Cor. Common to Secs. 19, 20, 29 & 30, T25N-R5W, Garfield Township  
August 3, 1862, GLO Resurvey by George H. Cannon set post for corner; Sugar 15° N 47° W 31 links; Sugar 12° S 50° E 27 Links.

November 12, 1902 and August 2, 1906, Surveys by Merrill, Co. Surveyor, Book 17 page 65-67. Stumps of old witness trees set new stake; Maple stump 30° S 49° W 22 links.

August 3, 1976, LCRC Norman Parker Liber 2, Page 2, found 1/2" Iron bar in blacktop near center line inter rds; set pk nail in face of 24" Ash N 55° W 66.35'; found bolt and washer in side PP S 45° W 56.70'.

January 25, 1978 Survey by Norman F. Parker Liber 2 Page 163, found angle iron for corner; PK nail in 24" Ash N 55° W, 66.35'; bolt in P.P. S 45° W 56.70'.

April 24, 1990 LCRC Robert Mitchell, Liber 2 Page 408; found 1/2" rerod; S 72° E 4" Elm, 126.24'; N 08° E 24" Maple, 159.96'; N 66° W 20" Maple 148.36'; S 42° W Red Pine 56.81'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-9: Sec. Cor. Common to Secs. 19, 20, 29 & 30, T25N-R5W, Garfield Township  
Found large nail 1' N of center line E-W road and 2.5' W of centerline road South from Liber 2 page 2 and Liber 2 Page 408; S 72° E, 126.24'; found nail in 8" Elm S 50° W, 56.88'; found nail and cap #16939 in power pole.  
No G.L.O. witnesses were found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-9: Sec. Cor. Common to Secs. 19, 20, 29 & 30, T25N-R5W, Garfield Township  
Found large nail over a 1/2" iron. Added mon box and 5/8" iron with brass cap. Corner is 1' N of center line E-W road and 2.5' W of centerline road South.

S 72° E, 126.24', 8" Elm, found nail  
S 40° E, 58.08', wood guard post tel. riser found nail  
S 50° W, 56.88', power pole, found nail and cap #16939  
N 40° W, 54.25', anchor pole, found nail

Kalkaska County Peer Group accepted the above monument as the best available evidence of the position of the original corner.

Ratified by Peer Group  
P.A. 345 - 1990 Kalkaska County


Chairman Eugene Farrier

Date 2-14-01

Signed by Eugene Farrier  
Surveyor's Michigan License No. 24594

Date 2-15-01

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

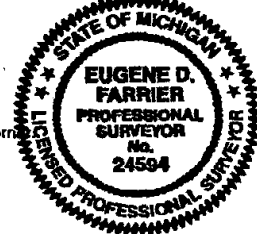

**3026806**  
Page: 1 of 1  
82/16/2001 10:28A  
REMON  
LB: 6 PG: 135

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 26, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1995