

NOV 21 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 004 PAGE 0072

For corners in

| | (County) | Located in: | | Corner Code # |
|------------------------------------|----------|-------------|-----|---------------|
| | | 18N | 12W | |
| 1. Public Land Survey | | T | R | C-8 |
| | | T | R | |
| | | T | R | |
| | | T | R | |
| 2. Property Controlling in Section | S | T | R | |
| | S | T | R | |
| 3. Miscellaneous | S | T | R | |
| Property in Sec. | S | T | R | |

REGISTER OF DEEDS

J. H. H. H.

Oct 29 2 59 PM '97

RECORDED
LAKE COUNTY, MI.

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Robert L. Wetherell

October 10, 97

I, _____, in a field survey on _____, 19_____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-8 - 1/4 Corner common to Sections 19 & 20, T18N, R12W, Lake Co., Mi.

1838 - John Hodgson, G.L.O.
16" Pine For 1/4 Corner

1929 - George Johnson, Co. Sur.
#1 - 30" Pine Stump N42°45'E 50'
#2 - Dead Cedar S5°15'W 57.3'

1951 - George Blass, LS 5489
Found 1-1/2" Iron Pipe
#3 - 10" Cedar S30°W 29.20'
#4 - 6" B. Oak N85°E 79.90'
#5 - 6" J. Pine N10°E 45.45'

(SEE OVER FOR CONTINUATION OF "A")

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-8 - 1/4 Corner common to Sections 19 & 20, T18N, R12W, Lake Co., Mi.

I found a 1-1/2" Pipe along side of a 12" Cedar Post. Corner is in fence line running East and West and is 22 feet East of fence line running North and South. The Found pipe was very old and of the variety commonly used by George Johnson.

Condition of the accessories are as follows: #1 gone (destroyed by gas pipeline), #2 Gone, #3 Found dead #4 Gone (destroyed by gas pipeline), #5 Gone, #6 Found in good condition, #7 Found in good condition, #8 Found in good condition, #9 Found in good condition.

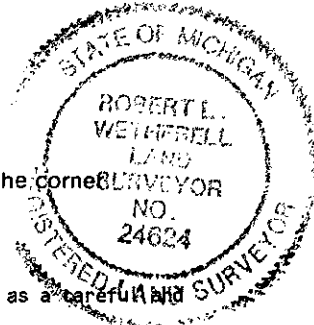
C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-8 - 1/4 Corner common to Sections 19 & 20, T18N, R12W, Lake Co., Mi.

I replaced the 1-1/2" pipe with a 3/4" x 24" rebar with Lake County Brass Cap, and is accepted as a faithful re-establishment of the position of the original corner.

11" B. Oak N82°E 84.05' (60d spike in N. side)
16" B. Oak S64°E 12.32' (60d spike in N. side) #7
8" Elm S15°W 44.89' (60d spike in E. side)
3" B. Oak S81°W 12.6' (center of tree)

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP
IN ACCORDANCE WITH P.A. 345
CHAIRMAN R. H. H.
DATE 10-23-97

Signed by Robert L. WetherellDate 10-28-97

Surveyor's Michigan License No. _____

NOV 21 1997

LIBER 004 PAGE 0073

CONTINUATION OF "A" - DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:
COMMISSION

1966 - Robert Griffin, LS 13584

Divided part of the N.1/2 of S.E.1/4, Sec. 19,
#6 - Set Iron 330' West of this corner

1978 - Carl Roser, LS 12028

L.C.R.C. - Liber 02, Page 344

Found 1" Pipe

#7 - 12" B. Oak S65°E 11.9'

#8 - 3" Pipe (gasline marker) N15°W 59.9'

#9 - Fence corner due West 22'